

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/14/94

CORNER DESIGNATION: V-7. South 1/4 corner Section 29, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Most recent approved GLO survey was made by Daniel Chaplin under Contract No. 107, dated September 21, 1864. Original notes state: Set stone 12 x 10 x 8 for 1/4 Sec. corner.

MONUMENT AND ACCESSORIES FOUND: Found stone, 12 x 10 x 8 inches, per record, lying on top of the ground, loose, 3.0 feet East of North, South, and East fence intersection, no marks found on stone.

MONUMENT MARKING DETAIL:

T2N R32E
 S29
1/4 _____
 S32
 1994
 PLS 1106

MONUMENT SET: After confirmation by survey, I accept the fence intersection as the best remaining evidence of the original corner location and set a 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe, 28" in the ground, with a mound of stone to the cap, (marked as shown in the monument detail). Set corner stone in mound West of monument.

New Accessories:


Set steel fence post with witness sign 1.8 foot North of monument.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 35 1/2° E-10.8 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 86 1/2° E-21.7 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 3° W-18.6 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 75° W-19.9 feet, top set 1 foot below ground.
Set steel fence posts near iron pins with witness signs attached.
Attached bearing object signs to each iron pin.

LOCATION & COMMENTS: Corner is located at fence intersection with fences extending North-South and East.

COMPASS DECLINATION: 18° East.
FIRM/AGENCY: William R. Wells, PLS
 P.O. Box 1696
 Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scot Munro

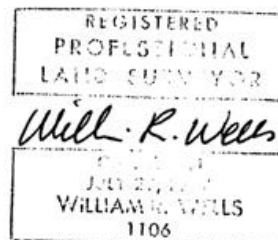

renews 12-31-94