

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/18/94

CORNER DESIGNATION: Z-21. Southeast corner Section 35, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Most recent official GLO survey was made by James P. Currin and James Noland, under Special Contract dated May 4, 1887. Notes state: found old mound 7 lks. S. of line. Set a basalt stone, 12 x 9 x 7 ins., 8 ins. in it for cor. to secs. 1, 2, 35, and 36. Marked 1 notch on E. and 5 on W. edges, 2 ft. high, 4 1/2 ft. base over it. Renewed pits and raised earth mound. Corner was re-established by LS 1097 in 1979, per Umatilla County Survey No. R-79-A.

MONUMENT AND ACCESSORIES FOUND: Found 2 1/2" brass cap on galvanized iron pipe set by LS 1097 in Umatilla County Survey No. R-79-A. Top of monument in 8" below road surface.

MONUMENT MARKING DETAIL:

T2N R32E

35		36
2		1

T1N R32E
1979
PLS 1097

MONUMENT SET:

Maintained corner.

New Accessories:

A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 42 1/2° E-65.2 feet.

A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 44 1/2° E-23.5 feet.

Power pole No. 9/30, with a brass washer stamped "PLS 1106" bears S 6° W- 19.4 feet.

Power pole No. 359060, with a brass washer stamped "PLS 1106" bears N 61° W- 38.1 feet.

Attached bearing object sign to each iron pin and above each brass washer on poles. Attached witness sign to steel fence post by each iron pin, and to power poles above each brass washer.


LOCATION AND COMMENTS: Corner falls in road at the intersection of Tutuilla Creek Road and County Road.

COMPASS DECLINATION: 18° East


FIRM/AGENCY: William R. Wells, PLS
P.O. Box 1696
Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scott Munro

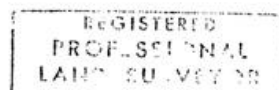

William R. Wells

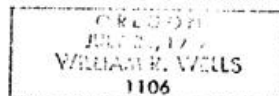

Renews 12-21-96