


History of original corner establishment:

This corner was searched but not recovered by L.E. Wilkes, U.S. Surveyor, during his surveys for the subdivision of Section 10 in 1917.

After Wilkes' 1917 survey, the corner may have been re-established by C.E. Redfield, U.S. Indian Service Surveyor during his surveys in the area between 1917 and 1920. Redfield reports a measurement along the West line of Section 14, but does not indicate if a monument was set.

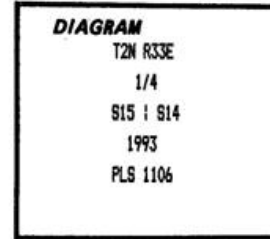

Corner No.  
Compass Declination: 18.0°

Description of corner evidence found:

Farming has removed all evidence of the original corner.

Re-established corner by single proportion measurement between the re-established Northwest and Southwest corners of Section 14.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2 1/2" brass cap on 1 1/4" by 30" galvanized iron pipe with top of pipe buried 12" below ground surface.

Bearing Objects to corner:

- A 5/8" by 30" iron pin bears N 60 1/2°E - 28.5', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 5/8" by 30" iron pin bears N 20°W - 43.1', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 1/2" by 15" iron pin bears S 70°W - 32.3'.
- A 1/2" by 15" iron pin bears S 22°E - 21.3'.

All pins have a Bearing Object sign wired on, and are buried with top of pin at least 12" below ground surface.

Set an 8' steel fence post 1.3' East of monument, and attached a Witness Corner sign.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

*expires 12-31-94*

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by .....

(COUNTY OFFICIAL)

(DEPUTY)

93-53-C