

OREGON CORNER RESTORATION FORM

Section: 12
Township: 5N
Range: 37 EWM
County: Umatilla
Date: 10/06/94
Corner Designation: H-21

Previous Renewals/Surveys, etc.: None

Monument(s) & Accessories Found (Condition & Source): None

Monument Detail: TOMKINS SURVEYING

T5N R37E
S 1/16
+
S11 S12
1994
WA 25893 OR 2360

Monument Set (Procedures & Description):

We ran a traverse North from the South Quarter of Section 12 to the Center Quarter of Section 12. Then we traversed from the Center-South 1/16 to the South 1/16 of Section 11 and Section 12, then North to the West Quarter of Section 12. Closure exceeded 1 in 5000. We previously broke down Section 12 as shown on Survey No. 92-106-C. A 2 inch aluminum cap on a 5/8" x 30" rebar was set at the corner position.

New Accessories:

A steel fence post with a land survey monument sign was placed alongside.
A 9" tamarack bears North 30° West, 20.0 feet marked "1/16 bt"
A 20" fir bears South 20° East, 15.4 feet marked "1/16 bt"

Location & Comments:


The corner falls on a small finger ridge on a West facing sidehill, in a North-South fence.

Compass Declination:

19° East

Surveyor's Seal


Firm/Agency: Paul Tomkins Land Surveying
6 1/2 N 2nd
Walla Walla WA 99362

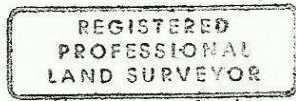

Party Chief: Thomas S. Butler

Paul W. Tomkins

Notes: Thomas S. Butler



Witness: Merle Sherman

RECEIVED BY
Umatilla County Surveyor
Date 11-94
Booked By KK
No. 94-152-R

renews 12/31/94
10/26/94