


RECORD OF SURVEY

LINE NO.	BEARING	DISTANCE	RECORD DIMENSIONS
L1	N 00°03'08" W	136.09'	[N 00°04'34" W 136.09']R2.. (S 00°04' E 2.06 ch)
L2	N 00°03'17" W	180.28'	(S 00°04' E 2.73 ch)

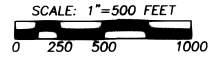

"BASIS OF BEARINGS": Measured bearings shown are True North based on G.P.S. geodetic observations at the West one-quarter corner of Section 19.

LEGEND

- Indicates Public Land Survey Corner reestablished and monumented with a 2 1/2" brass cap on 1 1/4" G.I.P. See Corner Certificate filed on separate sheets.
- Set 5/8" x 30" iron rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372".
- Indicates Public Land Survey Corner monumented on prior survey. Prior Survey Record Number is indicated. These corners are monumented with 2 1/2" brass caps on 1 1/4" galvanized iron pipes unless otherwise noted. Corner Certificates are on file at the Office of the Umatilla County Surveyor.
- Existing corner of record, as noted.
- Other monument found as noted.
- or - Calculated point only nothing set or found.
- (XOX) - Record dimension from GLO Survey by L.E. Wilkes, under Special Instructions, Group 29, dated Feb. 20, 1917.
- (XOX)CN - Record dimension from GLO Survey by Currin and Noland, under Special instructions dated May 4, 1887.
- (XOX)R - Record dimension from C.E. Redfield Surveys, circa 1918.
- [XOX] - Record dimension from Survey No. 92-016-B.
- [XOX]R1 - Record dimension from Survey No. 82-50-B.
- [XOX]R2 - Record dimension from Survey No. 93-054-C.

NARRATIVE:

This survey was made at the request of Steve Umbarger to partially subdivide Section 19, Township 2 North., Range 33 East., W.M. Controlling monuments found and used are indicated along with Record Survey data.

The East line of Township 2 North., Range 32 East., W.M., is the senior line. However, monuments set for Township 2 North., Range 33 East equal weight with those of Township 2 North., Range 32 East., W.M. The section was partially subdivided by the "3 Mile Rule", using the Currin and Noland record. The C.E. Redfield record for re-subdivisions within Section 19 could not be found in his fragmentary notes except for the line dividing the South Half of the Section.

Corner certificates for the public land survey corners reestablished are recorded with this Record of Survey.

The survey was made with using Trimble 5700 geodetic G.P.S. receivers operated in real time kinematic mode.

RECEIVED BY
Umatilla County Surveyors
 Date 01-03
 Rec'd By KR
 No. 03-03-B

Section Corner.
 See Survey No. 94-110-C

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Will R. Wells

OREGON
 JULY 22, 1977
 WILLIAM R. WELLS
 1106
 RENEWS 6/30/04

WILLIAM R. WELLS, PLS
 2602 N.E. RIVERSIDE PLACE
 P.O. BOX 1896
 PENDLETON, OR 97801
 PHONE: (541) 276-6362

DATE: 01/03 DR. BY: JMW
 CK. BY: WRW NO: 02-845

PROJECT:
 SURVEY FOR:
UMABARGER RANCH

LOCATED IN SECTION 19,
 T2N., R33E., W.M.,
 UMATILLA COUNTY, OREGON.

