

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner established by Manius Buchanan under GLO contract number 635 dated April 19, 1895. Surveyor General field notes state:

800 ft. above last creek on steep NE. face set a stone 24x10x9 ins. 18 ins. in the ground for cor. of secs. 28, 29, 32, and 33, marked with 1 groove on S. and 4 on E. edges and raised a mound of stone, 2 ft. at base, 1 1/4 ft. high, W. of Cor. Pits impracticable.

T 1 S R 35 E V-09

	S	
	28	

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position by survey I set a 5/8" x 30" iron pin, 27" in the ground, with 2 1/2" aluminum cap marked as shown below, in a mound of stone 1 1/2' diameter, from which:


NEW BEARING OBJECTS:

- A 18" Douglas Fir bears North 13° East a dist. of 45.15 ft., marked T1SR35ES28 BT.
- A 10'x30'x10' rock outcropping bears South 54° East a dist. of 101.20 ft., marked X BO.
- A 10" Douglas Fir bears South 10° West a dist. of 20.75 ft., marked T1SR35ES32 BT.
- A 10" Douglas Fir bears North 42° West a dist. of 75.60 ft., marked T1SR35ES29 BT.


Falls on steep W. aspect approx. 300' uphill of North westerly flowing creek.

I hereby certify that the corner was monumented on July 30, 2019.

Witness: Kyle A. Tucker

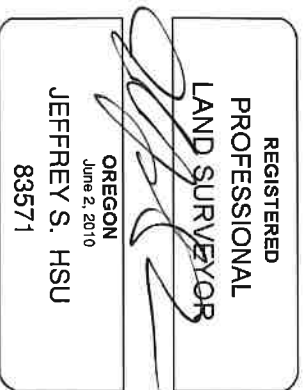

Renewal Date: June 30, 2021

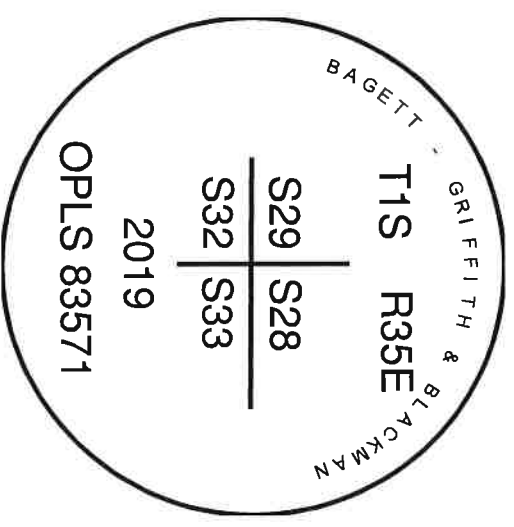

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees. Distance and bearing to the rock outcropping is to the center of the chiseled X.