

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 04/03/06

CORNER DESIGNATION: 3N31, Z-23, The South One-Quarter Corner of Section 36.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner established by Josiah A. Burnett, under Contract No. 92, dated September 12, 1860. Record states: Set a post for 1/4 Sec. corner, drove charred stake and raised mound with trench, as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N
R31E
1 S36
4 S1
T2N
2006
PLS 1106

MONUMENT SET:

Re-established corner by single proportionate measure, on the parallel of latitude, between the reestablished Southwest corner and recovered Southeast corner of Section 36. At reestablished corner point set a 2 3/8" brass cap on 1 1/4" x 30" galvanized iron pipe with cap 15" below ground level in a farmed field. Monument marked as shown in monument marking detail.

From which:

- A silver Deep-1 magnet buried 24" below ground level bears North 57 1/2° East, 32.3 feet.
 - A blue Deep-1 magnet buried 24" below ground level bears South 19° East, 39.3 feet.
 - A purple Deep-1 magnet buried 24" below ground level bears South 52 1/2° West, 35.6 feet.
 - An orange Deep-1 magnet buried 24" below ground level bears North 24 1/2° West, 30.4 feet.
- Buried bearing object signs with all magnets.

LOCATION AND COMMENTS: Corner is located in a farmed field. There are no definite features visible in the corner area.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 741471.15
E = 8615640.93


FIRM: William R. Wells, PLS
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

/3N31Z23

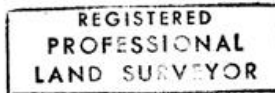

William R. Wells
OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

renews 6-30-08