

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 08/21/13

CORNER DESIGNATION: 3N32, E11, The North Quarter Corner of Section 9.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under Contract 107, dated September 1864, notes state: Set post for 1/4 Sec. cor. in mound of Earth with charred stake pits & c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N R32E
1 S4
4 S9
2013
PLS 54657

MONUMENT SET: Held the midpoint of a line between the Northeast and Northwest corners of Section 9 and extended due North to intersect an established East-West field line at the reestablished corner point. At reestablished corner point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe with top 20" below ground level in East-West field berm, marked as shown in "Monument Marking Detail", from which:

A silver deep-1 magnet buried 20" below ground level bears North 39° East, 41.2 feet.

A pink deep-1 magnet buried 20" below ground level bears South 33° East, 39.3 feet.

A blue deep-1 magnet buried 20" below ground level bears South 40° West, 41.4 feet.

An orange deep-1 magnet buried 20" below ground level bears North 33° West, 42.0 feet.

Buried bearing object tags with magnets.

LOCATION AND COMMENTS: Located in a East-West field line.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N= 768177.20'
E= 8631356.08'


FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS
Dean Roy

\3N32E11

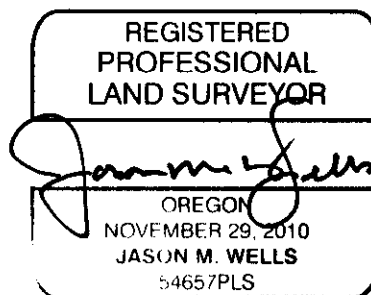

RENEWS: 6-30-14