

# SURVEY FOR FOREST SERVICE

UMATILLA NATIONAL FOREST CONTRACT NO. 53-04R3-5-1427  
 SECS. 24, 25, 36, T. 2 S. R. 34 E., W.M. UMATILLA COUNTY, OREGON.


SCALE: 1"=500' MAY-JULY, 1985

SURVEYOR: C.J. MARTIN RPLS 1910

MONUMENT FOUND ●

MONUMENT SET ○

MILE POINT COMPUTED ⊙

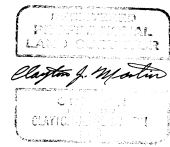

NOTE: SEE U.S.G.L.M. MANUAL OF SURVEYING INSTRUCTIONS 1973, CHAPTER 25, § 5.36 FOR COMPUTING 60 1/2 MILE POST.

- ① 60 Mile Post, Fd., nothing at Corner, 22" D.B.H. Ponderosa Pine (74"), S. 21° E., 107 lks., scribed 60MURBT, on an open face. 24" D.B.H. Douglas Fir, (18"), dead and down, S. 44° W., 171 lks., scribed 60MURBT, on an open face. Set; a 2 1/2" diam. alum. cap in a 2 1/2" X 30" alum. pipe at record distances from original B.T.'s. Cap mkd. per sketch. Raised mound of stones. 8" D.B.H. Douglas Fir, N. 80 3/4° W., 119.8', scribed 60MURBT.
- ② 60 1/2 Mile Post, Fd., no original evidence. Set; a 2 1/2" diam. alum. cap in a 2 1/2" X 30" alum. pipe at proportional point for Mile Post. Cap mkd. per sketch. Raised mound of stones. Cor. is at foot of rock slide, N. 20° E., Creek, NORTH, S. 4, 70 E. 17" DBH DOUGLAS FIR, NORTH, 27E, scribed 60 1/2 MURBT. 16" DBH WHITE FIR, S. 61° W., 4.5', scribed 60 1/2 MURBT.
- ③ 4" CC S. 24, S. 25, Fd., 2 1/2" diam brass cap on a 2" O.D. iron pipe extending 9" out of rock mound, cap mkd. per sketch. I stamp A.M. on monument. 18" D.B.H. (8" Pine) Douglas Fir, S. 44° E., (S. 57° E.), 48 lks., with double healed blazes. 2' high Pine stump, N. 80° E., (N. 70° E.), 59 lks., no mks. New B.T., 7" D.B.H. Douglas Fir, N. 46° E., 17.7', scribed T2SR34E324CCBT. Set; at the new Closing Corner, a 2 1/2" diam. alum. cap on a 2 1/2" X 30" alum. pipe, cap mkd. per sketch. Raised stone mound. 7" D.B.H. Douglas Fir, N. 74 1/2° E., 54.5', scribed T2SR34E324CCBT. This tree also referenced to orig. C.C.'s 5" D.B.H. Douglas Fir, S. 50° E., 22.6', scribed T2SR34E325CCBT.
- ④ Cor. Sec's. 24, 25, 19, 30, Fd., 2 1/2" diam. brass cap on a 2" iron pipe in a rock mound at foot of rock slide. Creek is 1 Ch. 1, East. Cap mkd. per sketch. 26" D.B.H. Tamarack snag, N. 65° E., 84.4', with scribes visible. (15" N. 44° E., 36 lks.) 17" D.B.H. Douglas Fir, N. 28° 45' W., 22.5' with healed face. (9", N. 26° 30' E., 36 lks.) 36" D.B.H. X 40" high, Douglas Fir snag, S. 78° 45' E., 28.6', with visible scribes. (S. 79° E., 44 lks.) 22" D.B.H. Douglas Fir snag, S. 71 1/2° W., 71.8', with healed face. (24" S. 68° W., 108 lks.) 22" D.B.H. Douglas Fir, N. 13 1/2° W., 91.8', with healed face. (10" N. 12° W., 141 lks.). 21" D.B.H. Douglas Fir, S. 40° W., 99.0', scribed T2SR34E325BT. 18" Tamarack, S. 30° E., 39.8', scribed T2SR34E325BT. Washer in bottom blaze of last 2 trees noted.
- ⑤ CC S. 24, S. 25, from West, Fd., 2 1/2" diam. brass cap set on a 2" O.D. iron pipe extending 17" out of rock mound. Cap mkd. per sketch. 22" D.B.H. (15") Douglas Fir, S. 59° W., (S. 50° W.) 37 lks., with double healed faces. 30" D.B.H. Ponderosa Pine, N. 50° W., (N. 60° W.), 51 lks., with low face on East with scribes, high face on South with scribes CCUR. The Amended Closing Corner is 45 links, West of Corner set by Wilkes, from which bears a 30" D.B.H. (24") Ponderosa Pine, North, (N. 50° W.) 26 lks. with high blaze on south scribed CCUR with low blaze on East with scribes. 22" D.B.H. Douglas Fir, (12" Pine) S. 36° E., (S. 30° E.) 26 lks., Bark scribed CCURBT. The A.M. Corner is a pile of stones.
- ⑥ 61 Mile Post, Fd., 2 1/2" diam. brass cap set on a 2" iron pipe extending 7" out of mound of stones, this is a Witness Corner. Cap mkd. per sketch. True Cor. is a 6" D.B.H. Fir, with open face on North and West, with scribing on both faces, 1.0' (1 lk.) S. 20° W., from cap. 10" D.B.H. (7") Douglas Fir, N. 62° E., 10 lks., with healed face. 10" D.B.H. (8"), Tamarack, S. 17° E., 19 lks., with double healed faces. 30" high stump with no marks, (30" diam.), N. 62° W., 20 lks..
- ⑦ 61 1/2 M. Fd. 2 1/2" diam. brass cap set on a 2" O.D. iron pipe ext. 11" out of rock mound. Cap mkd. per sketch. Rebuilt stone mound. 24" D.B.H. (18") X 6" high ponderosa stub, N. 25° W., 141 links with scribes visible on open face, lower face healed. 23" D.B.H. (14") Ponderosa pine, N. 40° 15' W., 123 links, with both faces healed. Set; 15" D.B.H. Douglas fir, N. 5° W., 109.0', scribed 61 1/2 MURBT.
- ⑧ CC S. 25, S. 36 A.M. Fd. 2 1/2" diam. brass cap set on a 2" O.D. iron pipe, extending 6" out of ground. Cap mkd. per sketch. U.S.G.L.O. cap. 15" (12") D.B.H. Ponderosa pine, N. 54° E., 246 links, with lower face healed, upper face has scribes. 33" (24") D.B.H. Douglas Fir, snag, S. 60° E., 29 links, with healed faces. Mkd., 10" D.B.H. Douglas Fir, S. 10° W., 44.5', scribed T2SR34E326CC BT. Set at Closing Corner S. 25, S. 36; 2 1/2" Alum. cap in a 2 1/2" X 30" Alum. pipe at closing corner. Cap mkd. per sketch. 15" D.B.H. Ponderosa pine, N. 54° E., 163.1', scribed by Wilkes in 1917. 10" D.B.H. Douglas Fir, S. 9° W., 44.4', scribed T2SR34E326CCBT.
- ⑨ CC S. 25, S. 36 Fd. 2 1/2" diam. brass cap set on a 2" O.D. iron pipe ext. 18" above grnd. Pipe is solidly set. Cap is U.S.G.L.O. and marked per sketch. Raised stone mound. Amended corner is small pile of stones, 47.5' West of brass cap, with 18" D.B.H. Ponderosa pine, (18" fir) S. 25° W., 3 links, upper blaze shows scribes CUR, lower blaze healed. Root hole, N. 46° E., 17.8', tree is dead and down with scribes UR. From brass cap, 25" (18") D.B.H. X 20" high, Douglas Fir snag, N. 68° 15' W., 41 links, with scribes visible on upper blaze, lower blaze healed. 10" Fir is now a stump with reverse on lower blaze, S. 35° 45' W., 78 links. Mark 7" D.B.H. White Fir, S. 43 1/2° W., 52.0', scribed CCUIRBT. 10" D.B.H. Douglas Fir, N. 45° W., 28.5', scribed CCUIRBT.
- ⑩ 62 M. Fd. 2 1/2" brass cap set on a 2" O.D. iron pipe ext. 6" out of ground. Cap marked per sketch, U.S.G.L.O. cap. Raised stone mound. 8" D.B.H. (6") fir snag, N. 23° W., 13 links, with scribes M62 in upper blaze. Lower blaze healed. 21" D.B.H. Douglas Fir (18"), S. 65° 30' W., 21 links with scribe visible in nearly healed upper blaze. Lower blaze healed. Set 10" D.B.H. White Fir, N. 57° W., 12.2', scribed 62MURBT.
- ⑪ 45.25 S. 36 Fd. 2 1/2" diam. brass cap set on a 1" O.D. iron pipe in a stone mound. Reset cap as it was loose and rebuilt stone mound. Cap mkd. per sketch. Cap is U.S.G.L.O. Corner is in meadow and 200' West of road. 20" D.B.H. (12") Ponderosa pine, N. 88° 45' E., 459 links, with healed double face. B.T. tag. (16") 29" D.B.H. Ponderosa pine, S. 6° 45' W., 24.4', with single healed face. B.T. tag.
- ⑫ Cor. Sec's. 25, 36, 30, 31, Fd. 2 1/2" diam brass cap set on a 2" O.D. iron pipe, in East rut of road. Fence, 3 1/2' East. Cap mkd. per sketch. Set steel post, West, 0.5', from mon. with property boundary and mon. signs attached. 17" D.B.H. White fir, S. 64° W., 24.6', with scribes R34E36 on upper blaze and BT in lower. 11" D.B.H. White fir, N. 65° W., 22', with scribes in partially healed upper and lower blazes. 12" D.B.H. White Fir, N. 27° E., 48.5', with scribes in partially healed upper and lower faces. 12" D.B.H. Tamarack, S. 40° E., 34.9' (S. 68° E., 24.6" on BT tag; note 12" white fir) with scribes on partially healed upper and lower faces. 24" D.B.H. X 7" high Fir stub, N. 39° E., 45 links, with scribes on open face. 26" D.B.H. Douglas fir (20") S. 65° E., 16 links with healed face, snag. 11" D.B.H. (10") X 12" high fir snag, S. 18° 30' W., 69 links, with scribes on an open face. 30" X 18" high pile of rot with BT reverse, N. 58° 30' W., 40 links, no other marks.

