

OREGON CORNER RESTORATION FORM


COUNTY: Umatilla. DATE: 03/19/20.

CORNER DESIGNATION: A-7, The North One-Quarter corner of Section 5, Township 1 North, Range 31 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner was originally established by Josiah A. Burnett under Contract No. 92 dated September 12, 1860. Notes state: Set post for 1/4 Sec. Cor., drove charred stake and raised mound with trench as per instructions.

MONUMENT AND ACCESSORIES FOUND: Found a 4 1/2' diameter mound of stone. There are old rock fencing mounds North and West from the mound. The corner area is very rocky in a drainage washed down to solid rock.

MONUMENT MARKING DETAIL:

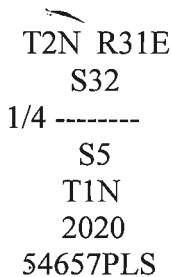

MONUMENT SET: At the center of the stone mound, set a 5/8 by 24" pointed rebar in hole drilled into solid rock. The top of the rebar is 10" above ground line and is capped with a 2" aluminum cap marked as shown in Monument Marking Detail. Surrounded the rebar monument with stones and placed a Witness sign in the stone mound on the North side of the corner.

New accessories:

- A 5/8 by 15" rebar with blue plastic cap marked "Wells Surveying 54657PLS" bears N 13°49' E, 36.9'.
 - A 5/8 by 15" rebar with blue plastic cap marked "Wells Surveying 54657PLS" bears S 77°59' E, 34.9'.
 - A 5/8 by 15" rebar with blue plastic cap marked "Wells Surveying 54657PLS" bears S 25°12' W, 46.6'.
 - A 5/8 by 15" rebar with blue plastic cap marked "Wells Surveying 54657PLS" bears N 77°07' W, 32.9'.
- Attached bearing object signs to the rebar accessories.
Bearings to corner accessories are State Plane Grid bearings.

LOCATION AND COMMENTS: Corner falls on a South facing rocky hillside about 200' North of a farm road.

OREGON STATE PLANE COORDINATE, North Zone NAD 83(91), International Feet Units:

N: 709595.62
E: 8595234.60

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

Surveyor's Seal

\1N31A-7



RENEWS: 6/30/20

20-043-C