

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


The corner was monumented in 1998, by Kaiser/Griffin/ Seibold, Cadastral Surveyors under Bureau of Land Management Group No. 1844. The field notes state:

Point for the East 1/16 corner of Sections 32 and 5

Set a stainless steel post, 28 ins. long, 2-1/2 ins. diam., 4 ins. in the ground, to solid rock, and supported in a mound of stone, 4 ft. base, to top, with brass cap.

No bearing trees available within limits.

Deposited a magnet in a white plastic case at the base of the stainless steel post.

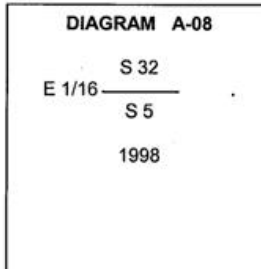

Description of corner evidence found:

Found 3-1/4" BLM brass cap marked per the diagram, in a large rock mound.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 5/8 x 24 inch rebar with 1-1/2 inch aluminum cap, bears N.34°W., 32.7 feet, stamped WSI/RM 32.7, 2535.
Set 5/8 x 24 inch rebar with 1-1/2 inch aluminum cap, bears South, 30.5 feet, stamped WSI/RM 30.5, 2535.

Reference monuments have an arrow pointing towards the corner. Appropriate signs have been attached to all bearing trees as required by this US Forest Service contract. 20° declination was used. Fieldwork was performed in July and August 2002.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Michael P. LeJeune

OREGON 11/06/02
JAN. 21, 1992
MICHAEL P. LE JEUNE
2535

EXPIRES 12/31/02

Prepared by: White Shield, Inc.
2515 W. Falls Ave.
Kennewick, WA 99336

Michael P. LeJeune,
Oregon PLS. 2535

Office ofCounty Surveyor....., County ofUmatilla.....,State of Oregon, I hereby certify that the within

instrument was filed in this office for record on theday of
David H. Lee
(County Official)

RECEIVED BY
Umatilla County Surveyor
Date 11-02
Rec'd By KK
No. 02-273-B

(Deputy)