

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla DATE: 11/09/16

CORNER DESIGNATION: E-19, The North Quarter Corner of Section 11, Township 1 South, Range 32 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Daniel Chaplin, Deputy Surveyor, under contract No. 107, dated September 21, 1864. Notes State: Set a post for Quarter Section corner in mound of earth with charred stake and pits, per instructions. Currin and Noland under special contract dated May 4, 1887, state finding a 12"x10"x10" basalt stone "above ground" for the corner. The "above ground" part was added later as indicated in the original notes. It is unclear whether "above ground" means the stone was not set and laying displaced above ground, or they forgot to add the set stone height above the ground.

MONUMENT AND ACCESSORIES FOUND: Held the intersection of fence lines extending South and West as the best remaining evidence of the original corner. At this point, there are remains of a rock jack fence corner. Old rotten wood and a pile of stones used to hold the rock jack down. The wood portion of a newer rock jack which is now broken is strewn Westerly 5' +/- with the fence wire still attached. There are many stones lying loose around this area as if someone looked for the corner stone mentioned in Currin and Noland's notes previously. I looked at the loose stones of correct size and also for any set stones in this area which may be the corner stone but did not find anything. There is a large rock dump area 10'+/- Westerly of the corner point.

MONUMENT MARKING DETAIL:

T1S R32E  
1 S2  
4 S11  
2016  
PLS 54657

MONUMENT SET: At the corner point set a 2 3/8" dia. brass cap on a 1 1/4"x30" galvanized iron pipe with the top of the cap 10" above ground level, and built a 3 1/2' diameter mound of stone surrounding the monument. Monument marked as shown in "Monument Marking Detail".

From which:

A 5/8"x24" iron rebar with 1 1/4" blue plastic cap marked "Wells Surveying PLS54657" 1" above ground level bears 11°07'06" (Grid Azimuth), 44.9 feet.

A 5/8"x24" iron rebar with 1 1/4" blue plastic cap marked "Wells Surveying PLS54657" 1" above ground level at rock jack fence corner bears 86°09'01" (Grid Azimuth), 84.5 feet.

A 5/8"x24" iron rebar with 1 1/4" blue plastic cap marked "Wells Surveying PLS54657" 1" above ground level at the Northwest corner of a bird guzzler roof corner bears 194°24'31" (Grid Azimuth), 54.3 feet.

A 5/8"x24" iron rebar with 1 1/4" blue plastic cap marked "Wells Surveying PLS54657" 1" above ground level bears 284°26'39" (Grid Azimuth), 49.7 feet.

Wired bearing object signs to all rebar. Set steel fence post with witness post sign 2.5' Southeast of the brass cap monument.


LOCATION AND COMMENTS: Corner is located at the intersection of a fence line extending South and West.

FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East Surveyor's Seal

/1S32E19

RECEIVED BY  
Umatilla County Surveyor  
Date: 12/30/16  
Rec'd By: CT  
No.: 16-114-B

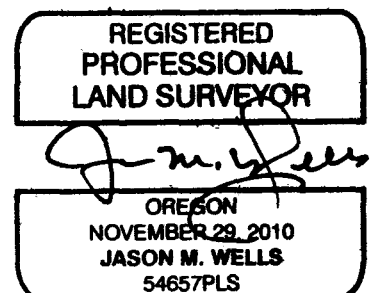

RENEWS: 6:30:18