


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-25

History of original corner establishment:

Original survey by Currin and Noland under special contract 1887, Set a charred post 36x3x3 ins. 2 ft. in the ground for 1/4 sec. cor. marked 1/4 S on W. face, from which A Fir, 12 ins. in diam. bears N 88°E 175 links dist. marked 1/4 S BT. A Pine, 20 ins. in diam. bears N 70°W 192 links dist., marked 1/4 S BT.

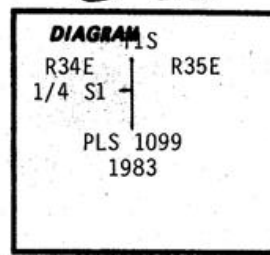

Subdivision of T1S R35E established closing corners for the sections East of this Range Line

Description of corner evidence found:

The original NE bearing tree, a 24" Douglas Fir, alive and in good condition with scribing "BT" visible on a previously opened blaze. And remains of the original NW bearing tree, a rotted Ponderosa Pine stump (cut during past logging operation) approx. 26" diameter, no scribing found.

No evidence remains of the original corner post.

Description of monument and accessories established to perpetuate the original location of this corner:

At the original corner point located by reference to the original bearing trees, we set a 2"x30" galvanized iron pipe, 25" in the ground with brass cap, marked: T1S

From which:

The original bearing trees previously described:

- A 24" Douglas Fir bears East 115.5 ft.
A 26" Ponderosa Pine stump bears N 68°W 127.3 ft.

We mark new BT's as follows:

- A 16" Ponderosa Pine scribed "S6 BT" on a double blaze bears N 20°E 25.3 ft.
An 8" Douglas Fir, scribed "1/4 S1 BT" on a double blaze bears N 61°W 64.5 ft.

Attached brass washer marked "LS 1099" to lower blaze of new BT's.

Staff Compass (19 1/2° East Declination) Steel Tape

September 27, 1983 Witnesses: Gary Langlitz Dick Humiston



Office of Surveyor... County of... State of... I hereby certify that the within instrument was filed in this office for record on the... day of... 1983... by Betty Cochran (DEPUTY)