


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established by Jacob C. Cooper in 1831 under General Land Office Contract No. 397.

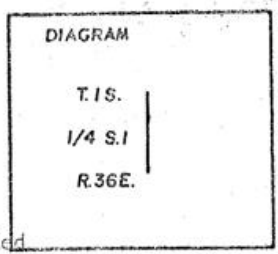

Surveyor General Records (Notes) states:
 Set post 3 1/2 ft. long, 3 in. sq. 15 in. in the ground on the North side of ravine 20 ft. above spring branch in dense timber for 1/4 Section Corner marked 1/4 S on the East and West faces, from which:
 A tamarack 1 1/4 in. diam. bears S24°W 5 lks. dist. marked 1/4 S BT.
 A spruce 8 in. diam. bears S11°E 16 lks. dist. marked 1/4 S BT.
 Corners for T1S R37E were set in subsequent resurvey.

C-25


(No subsequent remonumentations in county records)

Description of corner evidence found:

Found remains of original post from ground level to a depth of approximately 15 in.
 Found a 16 in. tamarack, live in good condition, with scribing visible, bearing S24°W 3.8 ft. from original post.
 Found 12 in. spruce, live in good condition, with scribing visible, bearing S11°E 11.2 ft. dist. from the original post.
 Accepted post as corner position.

Description of monument and accessories established to perpetuate the original location of this corner

Set 30 in. x 2 1/2 in. iron pipe with 3 in. brass cap marked as shown, 26 in. in the ground for the East 1/4 Corner to Section 1.
 No new bearing trees taken.
 Set a steel fence post approximately 5 ft. East from Corner with "Attention" sign attached.
 Used steel tape and magnetic compass with declination = 20° East.

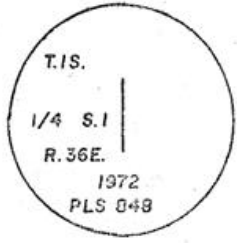

Office of Surveyor County of Washtenaw
 State of Ohio, I hereby certify that the within instrument was filed in this office for record on the 16 day of April, 1972, at 11 o'clock am, (signed) Douglas M. Ferguson by _____ (DEPUTY)