


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by Henry Meldrum under GLO contract number 450, dated June 11, 1882. Surveyor General record states:

Set post 3 ft long 3 ins square 24 in in ground for 1/4 sec cor marked 1/4 S on N face from which;

A pine 30 in diam bears N27°W 11 lks dist marked 1/4 S BT
A fir 18 in diam bears S30°E 12 lks dist marked 1/4 S BT

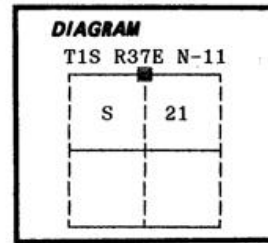

No record of subsequent monumentation found in Umatilla County survey records.

Description of corner evidence found:

Found the rotted remains of the original corner post to a depth of 10 inches.

ORIGINAL BEARING TREES

Found a 28 inch diameter White Fir S30°E, 12 lks, live with a broken top, with scribes visible.

Found a rotted Ponderosa Pine stump N40°W, 11 lks with no marks visible (Record N27°W)

Distances to the original BTs are to the estimated face of blaze.

Note:

Found a small mound of stone with a rotted post (no marks visible) approximately 6 feet West of the true corner. Both mound and stone were too recent to be the original corner monument.

Description of monument and accessories established to perpetuate the

original location of this corner: In place of the found original corner post, I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown, 26 inches in the ground, from which:

New BTs:

A 20 inch diameter Ponderosa Pine bears N7°E, 68.52 feet marked 1/4 S16 BT
A 13 inch diameter Ponderosa Pine bears S22°E, 22.08 feet marked 1/4 S21 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet East with land survey monument sign attached.

Raised small mound of stone around monument.

I hereby certify that the above corner point was perpetuated as hereon described on August 2, 1989.

Witness: Rick Robinson



I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of The Survey Dept. County of Umatilla
State of OR, I hereby certify that the within instrument was filed in this office for record on the 27th day of October, 1989
David H. Krumbein by Kathleen Krumbein
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

*GPO-591-971, 1988

RECEIVED BY
Date 10-89
Initials KA
No. 89-106-R