

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 01/24/06

CORNER DESIGNATION: 2N31, N-5, The Northeast Corner of Section 19.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Josiah A. Burnett, under Contract No. 92, dated September 12, 1860. Record states: Set a post for corner to Secs. 17, 18, 19 and 20. Drove charred stake and raised mound with trench, as per instructions. John Kimbrell, in survey recorded at Book 1, Page 348, recovered this corner. Record states: "...the original Corner to Secs 17-18-19-20 which is a Post in mound of Stone". A fence corner was called as the Section corner in BPA Pendleton-McNary Transmission Line Survey, maps dated 1950. Maps were found in County Assessors Office. Survey 03-293-B, PLS 933, states found fence corner as the Section corner.

MONUMENT AND ACCESSORIES FOUND:
Held an ancient fence corner with fence West and old rock jack mounds going North as best remaining evidence of the original corner position.

MONUMENT MARKING DETAIL:

T2N R31E
S18|S17
S19|S20
2006
PLS 1106

MONUMENT SET:

At a point just East of the fence corner post set a 5/8" x 24" iron rebar driven to bedrock, with top 3" above ground level. Attached a 2" diameter aluminum cap stamped as shown in monument marking detail.

From which:

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears North 23° East, 28.8 feet.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears South 31° East, 36.3 feet.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears South 14° West, 31.0 feet.

A 5/8" x 24" iron rebar with yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", bears North 40° West, 34.6 feet.

Attached bearing object signs to all rebar accessories. Attached witness sign to fence corner post West of corner.

LOCATION AND COMMENTS:

Corner is located on a steep and rocky Southwest slope.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 725427.13
E = 8592397.20

FIRM: William R. Wells, PLS
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Surveyor's Seal

Witnesses: Jason Wells, LSIT

/2N31N5



William R. Wells

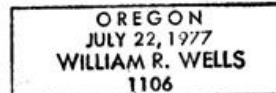

renews 6-30-08

06-462-C