

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N, R 32E., W.M.

Corner Code No. E-13

Note: Monument marked as shown below

History of original corner establishment:


This corner was originally established by D. Chaplin, U.S. Deputy Surveyor, under Contract No. 107, dated August 21, 1864. The original notes state that at the corner a wood post, with charred stake earth mound and pits was set for the corner.

In 1900, J.C. Arnold, during County Survey No. 50, recovered the original corner and re-monumented it. Arnold's record states "The corner of Sec's 3, 4, 9, and 10, which is the charred, lower end of the original post in old mound of earth, 20 ins. deep, verified by Dallas Price, present, who says he has preserved the corner for years. - At true cor. point, over old end of original post, I set a basalt stone, pyramidal shaped, sides average 9, 8 and 6 ins. and 16 ins. long. mkd. 5 notches on S. and 3 notches on E, with + on top."

In 1907, John Kjibrell recovered the corner when he reestablished the west 1/4 of Section 3.

More recent surveys, including the survey for West Hills Addition and Blue Mountain Heights Subdivision, indicate that a marked stone was found for the corner.

This corner was re-monumented in 1968, with the existing brass cap set in concrete. City of Pendleton corner card indicates that Ralph Thompson re-monumented the corner.

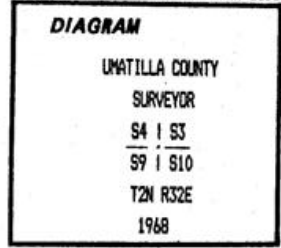

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Found a 2 1/2" brass cap set in a 5" diameter concrete cylinder, 2" above ground and 1' south of the centerline of a 12" by 12" concrete post.

Description of monument and accessories established to perpetuate the original location of this corner:

The existing corner monument is well preserved and substantial so it was left unchanged. Established references to the corner as follows. From the existing corner monument:

An aluminum nail in the south side of a 12" elm, bears S87°W 16.38'. The nail is about 1' above ground.

An aluminum nail in the west side of an 18" douglas fir bears S31°E 78.13'. The nail is about 1' above ground.

A cross chiseled in the south side of a 12" by 12" concrete post bears N5°W 0.60'.

Set steel fence post 1' N.E. of corner monument and attached witness corner sign.

No signs were attached to the reference trees because the corner falls in a residential and park area.

| |
|---|
| REGISTERED PROFESSIONAL LAND SURVEYOR <i>William R. Wells</i> OREGON JULY 22, 1977 WILLIAM R. WELLS 1106 |
|---|

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)