

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N, R 32E., W.M.

Corner Code No. G-21

Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by Daniel Chaplin, U.S. Deputy Surveyor, under Contract No. 107, dated September 21, 1864.


Z.F. Moody, U.S. Deputy Surveyor, in Contract No. 164, dated October 4, 1871, established a new corner. The Moody corner superceded the corner established by Daniel Chaplin.

In County Survey No. 11, in 1881, H.D. Chapman recovered the corner and used it in the subdivision of Section 11. Chapman was Deputy County Surveyor.

Currin and Noland, U.S. Deputy Surveyors, under Special Contract dated May 4, 1887, failed to recover the corner established by Moody, and used by Chapman in his subdivision of Section 11, and re-established the corner, terminating their survey at the South line of the Reserve Addition to the Town of Pendleton.

In 1968, PLS 346, re-established this corner by single proportion measure between the re-established Northeast and Southeast corners of Section 11. (Survey No. E-29-B).

Since 1968, this monument has been used for all surveys in the area.

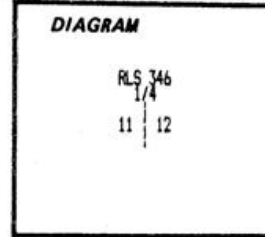

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Found a 2 1/2" brass cap on 1 1/4" galvanized iron pipe, buried 3.5' below ground in and abandoned road. Brass cap is marked as shown in corner diagram. This is the monument set in Survey No. E-29-B.

Based on Currin and Noland's survey in 1887, single proportion measure between the S.E. and N.E. corners of Section 11 may not be the proper method of re-establishing this corner. However, Currin and Noland disregarded the fact that the Section had been subdivided by H.D. Chaplin in 1881, based on Moody's survey.

I maintain this corner monument, as re-established in Survey No. E-29-B, but note that an angle point may exist in the Section line, because of the Currin and Noland and Moody surveys, between this East 1/4 corner of Section 11 and the Northeast corner of Section 11.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set steel fence post 2' South of the corner monument with witness corner sign attached.

Referenced the monument as follows:

- A brass washer on the Northeast side of PP&L Pole No. 119403, 1' above ground bears N 54°W 21.91'.
- A brass washer in a sawed off power pole, 1' above ground, bears S 13°E 10.36'.
- A double headed nail in the Northeast side of a power pole, 3.2' above ground bears S 55°W 57.34'.
- A double headed nail on the East side of PP&L Pole No. 119402, 1.5' above ground, bears N 75°W 45.04'.

Brass washers are stamped "PLS 1106".

Attached bearing object signs to each of the poles.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of Survey Dept County of Umatilla
State of OR I hereby certify that the within instrument was filed in this office
for record on the 7 day of July, 1990
David A. Krumpholtz by Kathleen K. Amosberry
(COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY
DATE 7-90
RECD. KA
No. 90-50-C