

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N , R 32E. , W.M.

Corner Code No. R-15


Note: Monument marked as shown below

History of original corner establishment:

Corner was originally established by Daniel Chaplin, under Contract No. 107, dated September 21, 1864. Set post in mound of earth, with charred stake, pits and etc., as per instructions.

Corner was reset by I.F. Moody, under Contract No. 165, dated October 4, 1871. Moody set a post with an earth mound around it.

Corner was recovered by Currin and Noland, under Special Contract dated May 4, 1887. Currin and Noland set a 1 1/8 x 7 inch stake, 6 inches in the ground in the position of the "Old Mound", dug pits East and West of corner and raised a mound of earth over the corner.

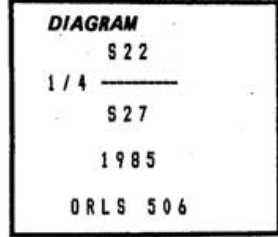

Corner No.  
Compass Declination: 18.0°

Description of corner evidence found:

2 1/2" brass cap on 1 1/4" galv. iron pipe, protruding 2 inches from ground.

This monument was set in 1985 by LS 506. No record for the monument was found in County Records.

Fences extend North-South and East-West from the corner.

Description of monument and accessories I established to perpetuate the original location of this corner:

Attached a Witness corner sign to fence corner post 0.6 feet Southeast of the monument.

New Bearing Objects:

- A 5/8" x 30" iron pin bears N 06° W - 22.8 feet.
- A 5/8" x 30" iron pin bears N 80° E - 14.9 feet.
- A 5/8" x 30" iron pin bears S 12 1/2° E - 17.0 feet.
- A 5/8" x 30" iron pin bears S 69° W - 17.0 feet.

All iron pins are capped with a 1 1/2" yellow plastic cap marked: "WR WELLS, PLS 1106". Bearing Object signs are wired to each pin.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

*expires 12/31/94*

Office of..... County of.....  
State of....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....  
..... by .....  
(COUNTY OFFICIAL) (DEPUTY)