

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 2N , R 33E. , W.M.

Corner Code No. J-17

Note: Monument marked as shown below

History of original corner establishment:

This corner was most recently re-established by L.E. Wilkes, U.S. Surveyor, during his subdivision of Section 10. This survey was made in 1917 under Group 29 Instructions dated September 3, 1917. Wilkes set a 3 foot long brass capped iron post for the corner in a grain field.

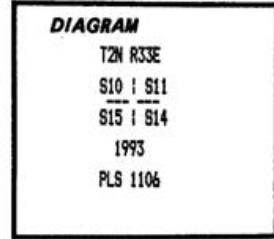

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Farming has removed all evidence of the original corner. This corner was re-established using the record calculated angle and distance tie from Agency Cemetery No. 2, Corner 2, using Wilkes' 1917 record (re-established corner by holding Wilkes' record calculated angle and distance from Corner 2, with backsight to Cemetery 2, Corner 1).

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2 1/2" brass cap on 1 1/4" by 30" galvanized iron pipe, with top of cap buried 16" below ground, stamped as shown in diagram.

Bearing Objects to corner:

- A 5/8" by 30" iron pin bears N 44°E - 30.1', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 5/8" by 30" iron pin bears N 39°W - 20.4', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 1/2" by 15" iron pin bears S 45 1/2°W - 30.4'.
- A 1/2" by 15" iron pin bears S 48 1/2°E - 24.0'.

All pins have a Bearing Object sign wired on, and are buried with top of pin at least 12" below ground surface.

Set an 8' steel fence post 1.3' North of monument, and attached a Witness Corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12-31-94

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)

93-53-C