


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E - 13
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 6, 1878, under GLO contract No. 293, as follows:

Set a stone, 18" x 12" x 10", on a northwest hillside for corner to sections 3, 4, 9 and 10. Raise a mound of stones around an alder stake in lieu of pits.

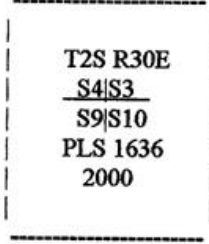

Original corner evidence recovered:

Found the original corner stone loosely set in a mound of stones. The corner stone is 19" x 11" x 8" and is plainly marked with 3 notches on one (east) edge and one notch on another (north) edge. The alder stake of record is gone.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" galvanized iron pipe 7" into the ground to bedrock. A 2 1/2" brass cap attached to the iron pipe is marked as shown in the diagram above. I place the corner stone horizontally along the west side of the pipe and build a mound of stones around the corner stone and pipe, from which:

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S3", attached at ground level, bears N63° 30'E, 119.2 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S10", attached at ground level, bears S47° 30'E, 143.4 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 S9", attached at ground level, bears S78° 15' W, 138.4 feet.

A 5/8" x 24" iron rod set 20" into the ground with a 3/4" brass washer, marked "PLS 1636 S4", attached at ground level, bears N47° 30'W, 141.5 feet.

I hereby certify the above corner point was perpetuated as hereon described on June 20, 2000. Magnetic declination set in compass: 18°E.

Renews June 30, 2001

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY
 Umatilla County Surveyor
 Date 6-20-00
 Rec'd by KR
 No. 00-137-R