

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E - 19
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 5, 1878, under GLO contract No. 293, as follows:

Set a stone, 20" x 10" x 7", for 1/4 section corner.

T2S R30E
1/4 S2
S11
PLS 1636
2002

Original corner evidence recovered:

Found the original corner stone solidly set in a small mound of stones, but tipped to the south. The corner stone is 22" x 10" x 7" and is plainly marked "1/4" on the south face.

Monument and accessories established to perpetuate the original position of this corner:

At the position occupied by the original corner stone, I set a 1" x 30" flared, galvanized iron pipe 19" into the ground to bedrock. I bury the corner stone along the north side of the pipe and build a mound of stones around the pipe. A 2 1/2" brass cap attached to the top of the pipe is marked as shown in the diagram above, from which:


A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N26° E, 166.3 feet.

A 5/8" x 24" iron rod set 22" into the ground with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S32° 30' E, 134.7 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S45° 30' W, 150.6 feet.

A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N9° W, 108.0 feet.

I hereby certify the above corner point was perpetuated as hereon described on May 31, 2002
Magnetic declination set in compass: 15° E (section corner 1/2 mile to the east is visible).

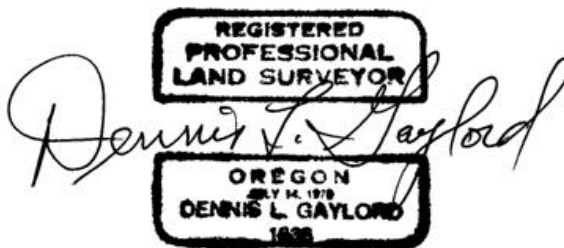

Renews June 30, 2003

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY
Umatilla County Surveyor
Date 6-02
Rec'd By KK
No. 02-165-B