


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

P - 25
DIAGRAM

History of original corner establishment:

The original corner was established on October 21, 1871, by George S. Pershin and George Williams under their joint GLO contract No. 154, as follows:

Set stone, 16" x 8" x 6", on east side, near top of hill, for 1/4 section corner.

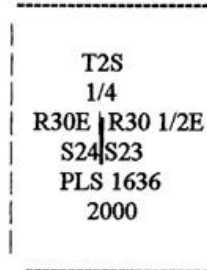

Original corner evidence recovered:

Found original corner stone solidly set in a mound of stones. The corner stone is 16" x 14" x 6" and is plainly marked "1/4" on the east face.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" galvanized iron pipe 17" into the ground to bedrock. A 2 1/2" brass cap attached to the iron pipe is marked as shown in the diagram above. I bury the original corner stone along the north side of the pipe and build a mound of stones around the pipe, from which:

A 5/8" x 24" iron rod, set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N67°E, 118.4 feet.

A 5/8" x 24" iron rod, set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S42°E, 103.1 feet.

A 5/8" x 24" iron rod, set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S15°W, 111.7 feet.

A 5/8" x 24" iron rod, set 24" into the ground with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N26° 30'W, 124.4 feet.

A 5 foot steel fence post with a "Witness Post" sign attached bears West, 1.0 foot.

I hereby certify the above corner point was perpetuated as hereon described on October 13, 2000. Magnetic declination set in compass: 18°E.



Renews June 30, 2001

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on: 10/17/2006

David H. Kha

RECEIVED BY
 Umatilla County Surveyor
 Date 10-00
 Rec'd By JK
 No. 00-216-2