


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T - 25
DIAGRAM

History of original corner establishment:

The original corner was established on October 21, 1871, by George S. Pershin and George Williams under their joint GLO contract No. 154, as follows:

Set stone, 22" x 12" x 3", on southeast hillside for 1/4 section corner.

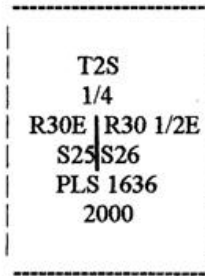

Original corner evidence recovered:

Found original corner stone solidly set 12" into the ground on the west edge of a small mound of stones. The corner stone is 22" x 17" x 4" and is plainly marked "1/4" on the west face.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" galvanized iron pipe 29" into the ground. A 2 1/2" brass cap attached to the iron pipe is marked as shown in the diagram above. I bury the original corner stone along the west side of the pipe and build a mound of stones around the brass cap, from which:

- A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N51° 30'E, 82.1 feet.
- A 5/8" x 36" iron rod, set 36" into the ground with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S22°E, 66.1 feet.
- A 5/8" x 24" iron rod, set 23" into the ground with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S39° 30'W, 73.0 feet.
- A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N29° 45'W, 90.0 feet.
- A 5 foot steel fence post with a "Witness Post" sign attached bears West, 2.0 foot.

I hereby certify the above corner point was perpetuated as hereon described on October 13, 2000. Magnetic declination set in compass: 18°E.

Renews June 30, 2001

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on: 10/17/2000

David H. Klein

RECEIVED BY
 Umatilla County Surveyor
 Date 10-00
 Rec'd By *JK*
 No. 00-220-B