

OREGON CORNER RESTORATION FORM

Section 30 Township 3N
County Umatilla Date: 09/25/09

Range 29E

Corner Designation: 3N29T1

1/4 corner common to sections 30, T3NR29E, 25, T3NR28E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by Gates in 1859. He set a post in a mound of earth.


Monuments and Accessories Found: (Condition and Source)

None.

Diagram

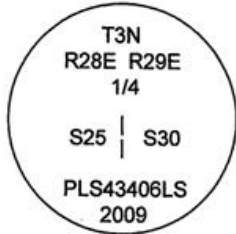

Sketch

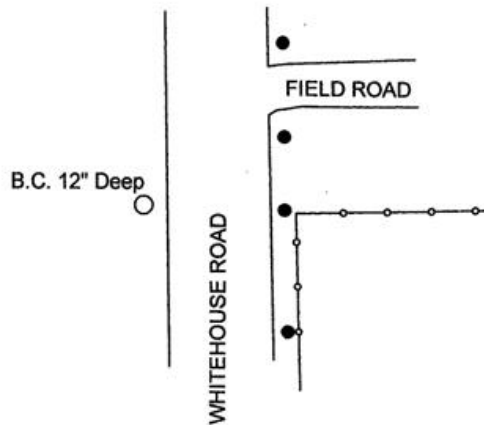

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N747844.88
E8521788.49

LAT - 45° 42' 40.06563" N
LON - 119° 14' 54.48398" W

Monument (s) Set (Procedures and Description)

Set a 2 1/2" Brass cap on a 1 1/8" x 30" galvanized iron pipe 13 inches below the surface by single proportionate measure. This position fits the projection of the intersecting fence from the East, and I held the line between the found Monuments North and South.

References Set:

- A 5/8" Iron rebar w/ypc #43406 lies N 65°15' E, 42.63'.
- A 5/8" Iron rebar w/ypc #43406 lies N 26°00' E, 106.15'.
- A 5/8" Iron rebar w/ypc #43406 lies S 86°30' E, 35.53'.
- A 5/8" Iron rebar w/ypc #43406 lies S 55°45' E, 40.83'.

Location and Comments

From the intersection of Whitehouse Road and Hwy. 320, go 1 mile South, along Whitehouse Road to the corner.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 10-09
Rec'd By: RE
No. 09-146-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/09