

OREGON CORNER RESTORATION FORM

Section 1 Township 3N Range 29E
County Umatilla Date: 08/20/10

Corner Designation: 3N29C25

1/4 Corner common to section 11, T3NR29E, and section 6, T3NR30E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by David P. Thompson in 1859. He set a post in a mound of earth.

Monuments and Accessories Found: (Condition and Source)

None

Diagram

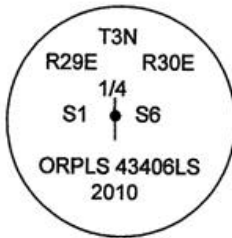

Orange Magnet ●

Sketch

Silver Magnet ●

○ 18" Deep
BC

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

Blue Magnet ●

● Pink Magnet

N769868.13
E8553696.01

LAT - 45° 46' 12.34516" N
LON - 119° 07' 19.58777" W

Monument (s) Set (Procedures and Description)

Set A 1"x30" flared galvanized iron pipe with a 2 1/2" B.C. by single proportionate method.

References Set: "Deep One" magnets by Berntsen.

An Orange magnet, 20" deep, lies N 29°00' W, 15.81'.

A Silver magnet, 20" deep, lies N 55°00' E, 17.17'.

A Pink magnet, 20" deep, lies S 47°00' E, 14.25'.

A Blue magnet, 20" deep, lies S 63°30' W, 17.55'.

Location and Comments

Corner is in an active wheat field
approx 1/2 mi. S of Stage Gulch road.
N of I-84.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English

OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 8-10
Rec'd By: KE
No. 10-136-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/11