

OREGON CORNER RESTORATION FORM

Section 8 Township 3N
County Umatilla Date: 09/01/09

Range 29E

Corner Designation: 3N29F7

1/16 Corner common to section 8, T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by N.H. Gates in 1859. He set a post in a mound of earth.
PLS 933 set a Brass Cap in 1974 in Survey 98-11-B.


Monuments and Accessories Found: (Condition and Source)

Found A 2 1/4" B.C.

Diagram

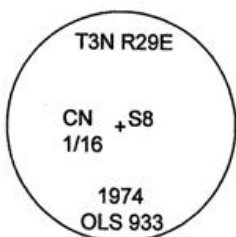

Sketch

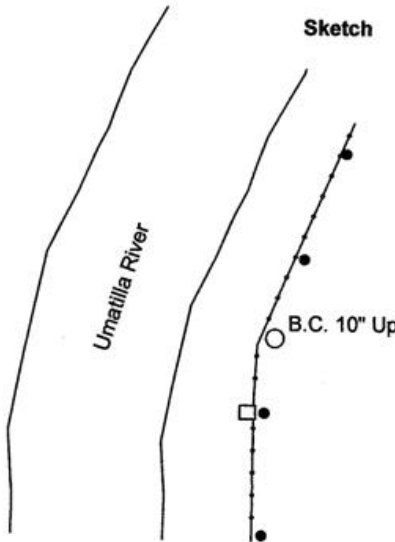

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N765348.12
E8530052.78

LAT - 45° 45' 31.57728" N
LON - 119° 12' 54.11486" W

Monument (s) Set (Procedures and Description)

None.

References Set:

- A $\frac{1}{16}$ " x 30" Iron rebar w/ypc #43406 lies N34°30' E, 30.72'.
- A $\frac{1}{16}$ " x 30" Iron rebar w/ypc #43406 lies N 32°30' E, 11.94'.
- A $\frac{1}{16}$ " x 30" Iron rebar w/ypc #43406 lies S 21°45' W, 10.00'.
- A $\frac{1}{16}$ " x 30" Iron rebar w/ypc #43406 lies S 19°30' W, 29.57'.

Location and Comments

The corner is $\frac{1}{4}$ mile West of the North end
of the City of Echo Reclamation Ponds. Go across the
Echo-Stanfield freeway overpass towards Echo, then
make an immediate right onto a dirt road. From there
you follow the road until you cross the canal, then go
 $\frac{1}{4}$ mile South and make a right to a farm house. The
Corner is approx. 500 feet West of the house.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY II, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 10-09
Rec'd By: KE
No. 09-146-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/09