

OREGON CORNER RESTORATION FORM

Section 21,22,27,28
County Umatilla

Township 3N
Date: 0/11/7/11

Range 29E

Corner Designation: 3N29R13

Corner common to sections 21,22,27 and 28, T3NR29E.

_____	Condition Report Only
<u> X </u>	Not Found
<u> X </u>	Remonumented
_____	Unrecorded
<u> X </u>	Surveyed In
<u> X </u>	Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by N.H. Gates in 1859. He set a post in a mound of earth.

Monuments and Accessories Found: (Condition and Source)

None.

Diagram

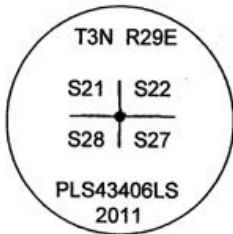

Sketch

- Orange Magnet
- Silver Magnet
- 2 1/2" B.C.
24" Deep
- Blue Magnet
- Pink Magnet
- Crop Circle

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N750963.37
E8538177.80

LAT - 45° 43' 08.27978" N
LON - 119° 11' 02.82648" W

Monument (s) Set (Procedures and Description)

A 1"x30" galvanized iron pipe with a 2 1/2" Brass cap, 24" below surface, stamped as shown above. Near an irrigation pivot. Corner set by double proportionate method.

References Set: "Deep One" magnets by Berntsen.

- An Orange magnet 24" deep lies N 17°00' W, 30.38'.
- A Blue magnet 24" deep lies S74 °15' W, 24.27'.
- A Silver magnet 24" deep lies N 22°15' E, 23.11'.
- A Pink magnet 24" deep lies S 64°30' E, 16.61'.

Location and Comments

The corner is in the irrigated circle
North of the Farm House at the Piercy
Vineyard.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY II, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/11

RECEIVED BY:

Date: 1-11
Rec'd By: KK
No. 11-06-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055