

OREGON CORNER RESTORATION FORM

Section 28,33 Township 3N
County Umatilla Date: 08/09/10

Range 29E

Corner Designation: 3N29V11

Corner common to section 28 and 33 T3NR29E.

Condition Report Only
 Not Found
 Remonumented
 Unrecorded
 Surveyed In
 Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by Gates in 1859. He set a post in a mound of earth.

Monuments and Accessories Found: (Condition and Source)

None.

Diagram

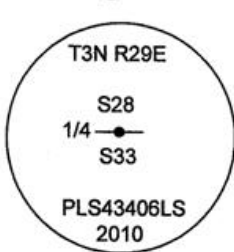

Blue Magnet 22" Deep •

Sketch

Silver Magnet 20" Deep •

○ BC 18" Below Surface

Silver Magnet 20" Deep •

• Blue Magnet 21" Deep

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N745592.25
E8535662.24

LAT - 45° 42' 15.660302" N
LON - 119° 11' 39.501663" W

Monument (s) Set (Procedures and Description)

A 1 1/2" x 30" galvanized iron pipe with a 2 1/2" Brass cap, stamped as shown above. Set by single proportion method.

References Set: Deep One magnets by Berntsen.

- A Blue magnet, 22" deep lies N 67° W, 16.33'.
- A Silver magnet, 20" deep lies N 27°15' E, 15.52'.
- A Blue magnet, 21" deep lies S 50° E, 14.17'.
- A Silver magnet, 20" deep lies S 26°10' W, 16.55'.

Location and Comments

Corner falls in the W edge of an active alfalfa field and circle irrigation. S. of Piercy's Vineyard.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 8-10
Rec'd By: KK
No. 10-1462

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/11