

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla DATE: 09/19/13

CORNER DESIGNATION: 3N32, E17, The Northwest Corner of Section 11.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under Contract 107, dated September 1864, notes state: Set post for corner to secs. 2, 3, 10 & 11 in mound of Earth with charred stake pits & c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N R32E  
S3 | S2  
S10 | S11  
2013  
PLS 54657

MONUMENT SET: Held the position of an old steel fence post after confirming position by survey. At position of old steel fence post reestablished corner with a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with top flush with ground, reset post 1.0 feet North with witness post sign attached, marked as shown in "Monument Marking Detail", from which:

- A silver deep-1 magnet, buried 20" in the ground, bears North 58° East, 32.5 feet.
  - A pink deep-1 magnet, buried 20" in the ground, bears South 36 1/2° East, 30.7 feet.
  - A blue deep-1 magnet, buried 20" in the ground, bears South 60° West, 31.3 feet.
  - An orange deep-1 magnet, buried 20" in the ground, bears North 38° West, 35.2 feet.
- Buried bearing object tags with magnets.

LOCATION AND COMMENTS: Corner falls at position of old steel fence post in a farmed swale.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:


N= 768322.74'  
E= 8639277.77'

FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS  
Dean Roy  
\3N32E17

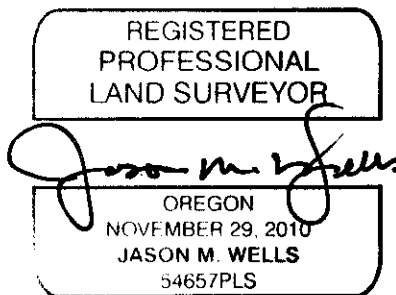

RENEWS: 6-30-14