

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 07/10/13

CORNER DESIGNATION: 3N32, N19, The North Quarter Corner of Section 23.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under GLO Contract dated September 1864, notes state: Set post for 1/4 Sec. corner in mound of Earth with charred stake, pits, trench &c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N R32E
1 S14
4 S23
2013
PLS 54657

MONUMENT SET: At intersection of centerline of Fulton Road with fence and field line South. Set a 2" aluminum cap on a 5/8" x 24" iron rod, 1" below asphalt surface stamped as stated in "Monument Marking Detail", from which:

A 5/8" x 24" iron rod with a purple plastic cap marked "Wells Surveying, PLS 54657" bears North 34° East, 29.0 feet.

A 5/8" x 24" iron rod with a purple plastic cap marked "Wells Surveying, PLS 54657" bears South 59 1/2° East, 48.1 feet.

A 5/8" x 24" iron rod with a purple plastic cap marked "Wells Surveying, PLS 54657" bears South 33 1/2° West, 37.4 feet.

A 5/8" x 24" iron rod with a purple plastic cap marked "Wells Surveying, PLS 54657" bears North 71° West, 57.9 feet.

Attached bearing object tags to all accessories.

LOCATION AND COMMENTS:

At centerline of Fulton Road with fence and field line South.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:


N= 757833.61
E=8642153.49

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS
Dean Roy
3N32N19

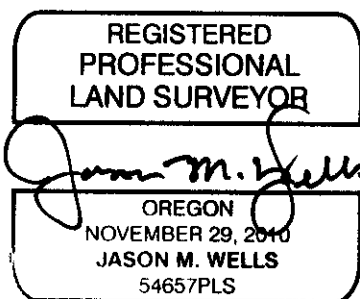

RENEWALS: 6-30-14