

OREGON CORNER RESTORATION FORM

Section: 14, 15 Township: 3N Range: 33E
County: Umatilla Date: 3/15/2012

Corner Designation: 3N33L17

Quarter corner common to Sections 14, 15, T3NR33E.

_____	Condition Report Only
X	Not Found
X	Remonumented
_____	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth, with charred stake and pits.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

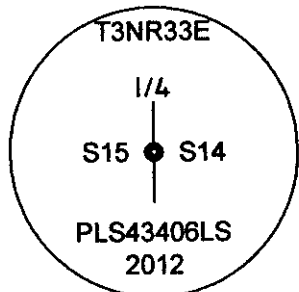

Sketch

ORANGE
MAGNET ●

SILVER
MAGNET ●

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N761041.35
E8671145.09

BLUE
MAGNET ●

○ BC

● PINK
MAGNET

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.5' below the surface. The corner location was reestablished by single proportionate method between neighboring corners to the North and South. A faint, old plow berm is visible to the West.

References Set:

- "Deep One" magnets by Berntsen.
- An orange magnet lies N 28° 15' W, 38.04', 1.5' deep.
- A silver magnet lies N 24° 30' E, 39.38', 1.6' deep.
- A pink magnet lies S 87° 25' E, 18.31', 1.5' deep.
- A blue magnet lies S 75° 30' W, 27.68', 1.6' deep.

Location and Comments:

The corner is located 1/2 mile South and 1/2 mile West of the intersection of Shafer Rd. and the Helix Hwy., in a CRP field.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English

OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Date: 7/10/2012
Rec'd By: S. Gles
No. 12-094-C

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055