

OREGON CORNER RESTORATION FORM

Section: 23, 24
County: Umatilla

Township: 3N
Date: 3/9/2012

Range: 33E

Corner Designation: 3N33P21

Quarter corner common to Sections 23, 24, T3NR33E.

_____	Condition Report Only
X	Not Found
X	Remonumented
_____	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth, with charred stake and pits.
In 1871 Moody set a post in a mound of earth.
In 1887 Currin and Noland set a post in a mound of earth and dug pits to the North and South.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

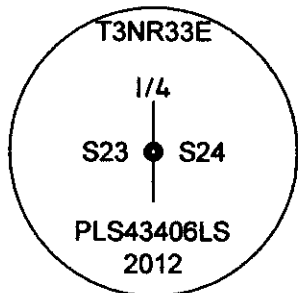

ORANGE
MAGNET

Sketch

SILVER
MAGNET

FIELD LINE

BC

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

BLUE
MAGNET

PINK
MAGNET

N755874.67
E8676546.67

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.6' below the surface. The corner location was reestablished by single proportionate method between neighboring corners to the North and South, in an active wheat field.

References Set:

"Deep One" magnets by Berntsen.
An orange magnet lies N 48° W, 30.81', 1.7' deep.
A silver magnet lies N 45° 15' E, 29.15', 1.6' deep.
A pink magnet lies S 44° 50' E, 26.08', 1.8' deep.
A blue magnet lies S 50° 10' W, 25.27', 1.6' deep.

Location and Comments:

The corner is located 3/4 mile Northeast of the intersection of Hwy. 11 and the Helix Hwy., in an active wheat field, approximately 25' South of an East-West field line.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Firm / Agency

Date: 7/10/2012
Rec'd By: S. Oles
No. 12-094-C

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055