

OREGON CORNER RESTORATION FORM

Section: 25, 36 Township: 3N Range: 33E
County: Umatilla Date: 12/21/2011

Corner Designation: 3N33V23

Quarter corner common to Sections 25, 36, T3NR33E.

	Condition Report Only
X	Not Found
X	Remonumented
	Unrecorded
X	Surveyed In
X	Referenced Out

Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth with charred stake and pits.

In 1871 Moody set a post in a mound of earth.


In 1887 Currin and Noland buried charred stake under a mound of earth, dug pits East and West, and set a stake in the East pit.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

Sketch

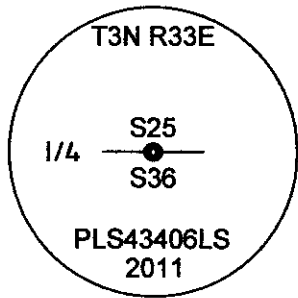

ORANGE
MAGNET

SILVER
MAGNET

DUFF RD.

BC

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

BLUE
MAGNET

PINK
MAGNET

N748030.73
E8679330.48

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.2' below the surface.

The corner location was reestablished by single proportionate method from neighboring corners East and West.

References Set:

"Deep One" magnets by Berntsen.

An orange magnet lies N 33° W, 29.12', 1.6' deep.

A silver magnet lies N 33° 40' E, 29.31', 1.6' deep.

A pink magnet lies S 43° 50' E, 22.10', 1.5' deep.

A blue magnet lies S 43° 30' W, 22.25', 1.7' deep.

Location and Comments:

The corner is located 2 1/2 miles East of the intersection of Hwy. 11 and Duff Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English

OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

Date: 7/10/2012
Rec'd By: A. Oles
No. 12-094-C

RENEWAL DATE: 12/31/13