

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 12/29/15

CORNER DESIGNATION: P-9, The East Quarter Corner of Section 20, Township 3 North, Range 35 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Currin and Noland under special contract dated May 4, 1887. Notes state: deposit charred stake 12 ins. in the ground for ¼ sec. corner. Record of private survey No. 96 by Kimbrell circa 1898, state he commenced his survey at the ¼ corner between sec. 20 and 21, (Currin and Noland's corner). Record of private survey No. 328 by Kimbrell circa 1910, state he set a post for the ¼ sec. corner.

MONUMENT AND ACCESSORIES FOUND: None. Single proportioned the corner based on found or set monuments North and South of the corner. See Property Line Adjustment Survey map filed concurrently with this certificate for further details.

MONUMENT MARKING DETAIL:

T3N R35E
1/4
S20|S21
2015
PLS 54657

MONUMENT SET: At the corner point in a farmed field set a 2 3/8" brass cap on 1 ¼"x30" galvanized iron pipe with top 20" below ground level. Monument marked as shown in "Monument Marking Detail".

From which:


A silver Deep-1 magnet buried 22" in the ground bears GRID AZIMUTH 26°36', 31.5 feet.
A 5/8"x24" iron rebar with 1 ¼" blue plastic cap marked "Wells Surveying PLS 54657" 2" above ground level in field road bank bears GRID AZIMUTH 176°51', 46.9 feet.
A 5/8"x24" iron rebar with 1 ¼" blue plastic cap marked "Wells Surveying PLS 54657" 2" above ground level in fence line bears GRID AZIMUTH 216°01', 49.2 feet.
A ¾" diameter brass washer stamped PLS 1106, 0.50' above ground level in railroad tie fence corner post bears GRID AZIMUTH 267°32', 35.8 feet.
Buried bearing object tags with magnets. Wired bearing object tags to rebar. Nailed bearing object tag and witness post sign to railroad tie near brass washer.

LOCATION AND COMMENTS: Corner is located in a farmed field at the end of a field road just East of a road berm between a farmed field and a field road. See Survey Map filed concurrently with this certificate for further information.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East Surveyor's Seal

/3N35P9

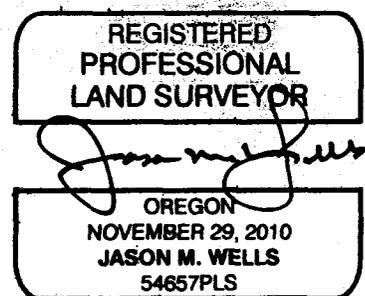

RENEWS: 6:30:16

16-011-C