


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

N-09

History of original corner establishment:

1879, George S. Pershin, U.S. Deputy Surveyor, while surveying a portion of the township under General Land Office Contract No. 340 established the corner as follows:
 Set Basalt Stone 16 X 12 X 7 on N.W. face of spur for cor. to Sec. 16, 17, 20 & 21
 A Fir 24 in. di. brs. N. 48° E. 166 lks dist
 no other green trees near

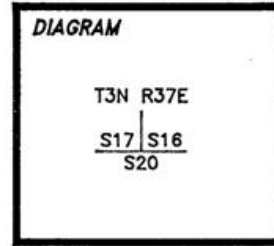

1900, William E. Campbell, U.S. Deputy Surveyor, while retracing the south boundary of sections 13 - 18 and completing the subdivision of the township under General Land Office Contract No. 718 described the corner as follows:
 S. 89°45' W., on a blank line, S. bdy. of sec. 16; at 79.22 chs. intersect temp. closing cor. of secs. 20 and 21; and at 80.11 chs. intersect the cor. of secs. 16 and 17, which is a basalt stone 16 X 12 X 7 ins. on N.W. face of spur. marked and witnessed as described by the surveyor-general.

2002, David A. Schlaich, Registered Land Surveyor No. 2308, found on the northwest slope of a spur ridge a basalt stone 17" X 12" X 7", projecting 4" out of the ground, with 4 notches on the East edge and 3 notches on the southerly end of the top edge, from which:
 28" Douglas Fir Snag bears N. 53° E., 106.3 feet (record N. 48° E. 166 links), with rotted out partially healed blaze (no scribing remains).
 Replaced the stone with a 2 1/2" by 30" aluminum pipe, with a 3 1/4" aluminum cap set 25" in the ground, with a white SURV-KAP magnetic reference monument set in the bottom of the hole. Buried original stone on the North side of the aluminum monument, from which:
 14" Douglas Fir, with a triple top, bears N. 67° E., 84.1 feet, scribed "T3N R37E S16"BT".
 RM, 5/8" by 24" rebar with a 1 1/4" diameter yellow plastic cap stamped "UMATILLA N.F.", set 13" in the ground, bears N. 78°19' E., 36.39 feet.
 6" Douglas Fir, bears S. 46 1/2° E., 14.3 feet, scribed "X"BT".
 9" Western Larch, bears N. 47 1/2° W., 33.3 feet, scribed "T3N R37E S17"BT".
 The bearing trees are double blazed and have a 3/4" diameter brass washer stamped "RLS 2308" nailed to the lower blaze between the "BT" scribing.

Description of corner evidence found:

Found a 2 1/2" aluminum pipe, with a 3 1/4" aluminum cap, projecting 5" out of the ground, marked as shown, from which:
 28" Douglas Fir Snag bears N. 53° E., 106.3 feet, with rotted out partially healed blaze (record N. 48° E. 166 links = 109.6 feet).
 14" Douglas Fir, with a triple top, bears N. 67° E., 84.1 feet, scribing "T3N R37E S16"BT" visible on double blaze with 3/4" brass washer "RLS 2308" nailed to the lower blaze.
 RM, 5/8" rebar, with a 1 1/4" yellow plastic cap stamped "UMATILLA N.F.", projecting 11" out of the ground, N. 78°19' E., 36.39 feet.
 6" Douglas Fir, bears S. 46 1/2° E., 14.3 feet, scribing "X"BT" visible on double blaze with 3/4" brass washer "RLS 2308" nailed to the lower blaze.
 9" Western Larch, bears N. 47 1/2° W., 33.3 feet, scribing "T3N R37E S17"BT" visible on double blaze with 3/4" brass washer "RLS 2308" nailed to the lower blaze.



Description of monument and accessories I established to perpetuate the original location of this corner:

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

David A. Schlaich

OREGON
JULY 16, 1987
DAVID A. SCHLAICH
2308

RENEWAL DATE: 06/30/2006

DATUM: NAD83(1991)

STATE PLANE COORDINATES: Oregon North Zone in International Feet

Latitude	Longitude	Northing(y)	Easting(x)
45°43'48.37256" North	118°12'42.32649" West	760561.217	8786353.802

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 20.....
 by.....
 (COUNTY OFFICIAL) (DEPUTY)