


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

P - 5
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 16, 1879, under GLO contract No. 332, as follows:

Set a basalt stone, 14" x 12" x 4", on east hillside for the 1/4 section corner to sections 19 and 20.

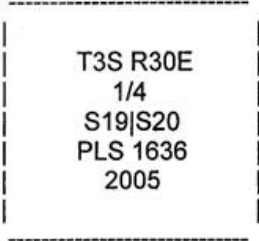

Original corner evidence recovered:

Found the original corner stone loosely set on the northeast edge of a mound of stones. The corner stone is 16" x 16" x 4" and is plainly marked "1/4" on the one face.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 18" flared, galvanized iron pipe 12" into the ground to bedrock. A 2 1/2" brass cap attached to the top of the pipe is marked as shown in the diagram above. I bury the corner stone along the northwest side of the pipe and build a mound of stones around the pipe, from which:

- A 5/8" x 24" iron rod set 23" into the ground, with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N50° E, 77.7 feet.
- A 5/8" x 24" iron rod set 23" into the ground, with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S30° E, 55.9 feet.
- A 5/8" x 24" iron rod set 23" into the ground, with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S72° W, 128.5 feet.
- A 5/8" x 24" iron rod set 23" into the ground, with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N23° W, 79.6 feet.

I hereby certify the above corner point was perpetuated as hereon described on February 8, 2005. Magnetic declination set in compass: 16° E.
NAD '83 UTM Zone 11 position: 5017524N, 333354E (plus or minus two meters).



Renews June 30, 2005

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY
Umatilla County Surveyor
Date 2-05
Rec'd by KK
No. 05-31-R