


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-17

History of original corner establishment: Corner originally established by George S. Pershin, U.S. Deputy Surveyor, under Contract No. 319, dated March 26, 1879. The original notes state that at the corner a 18" x 12" x 5" basalt stone was set on nearly level surface from which:

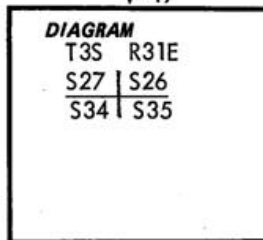

- A 18" dia Fir bears N20°E 60 lks dist.
- A 6" dia Pine bears S20°E 10 lks dist.
- A 6" dia Pine bears S21°W 32 lks dist.
- A 30" dia Pine bears N34°W 48 lks dist.

Corner was remonumented in 1978 by BLM, see sheet 2 for history of BLM remonumentation.

Description of corner evidence found:

- 3" brass cap on 2 1/2" dia l. pipe protruding 6" from ground with mound of stone from which:
- A 24" dia Pine Stump bears N32°W 32.2 ft dist tagged S32E 32.2 ft dist (old BT, rotted out visible scribing).
- A 22" dia Ponderosa Pine bears S21°W 21.7 ft dist tagged N21°E 32 lk dist (old BT, healed blaze).
- A 11" dia Red Fir bears N46°E 45.1 ft dist tagged S45°W 68 1/2 lk dist. - recent blaze.
- A 11" dia Red Fir bears S49°E 19.9 ft dist tagged N47 1/2°W 30 1/2 lk dist. - recent blaze.
- A 17" dia Red Fir bears N41°W 23.8 ft dist tagged S41°E 35 lk dist - recent blaze.


Description of monument and accessories I established to perpetuate the original location of this corner:

Set steel fence post with 54-4 sign attached, South of corner. Blaze faces and 6" bands around bearing trees are painted red. Tagged trees with 54-3 & 4 signs where needed. Used steel tape and magnetic compass 19 3/4° East declination. Measured to center of BTs.

Corner maintained on October 7, 1982.

Standard BLM. Cap marked:

Witnessed by: Leslie E. Wilson

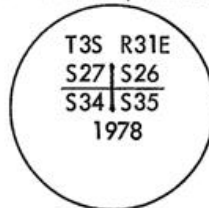

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of... County Surveyor... Umatilla... State of... Oregon... I hereby certify that the within instrument was filed in this office for record on the... day of... 1982... by... (DEPUTY)

RECEIVED BY Umatilla County Surveyor Date Rec'd by No. 82-138-B

History of 1978 BLM Remonumentation-(From BLM Field Notes)

The cor. of secs. 26, 27, 34, and 35, monumented with the original basalt stone, 18 x 12 x 5 ins., firmly set 8 ins. in the ground, mkd. with 3 notches on E. and 2 notches on S. edges, from which the remains of the original bearing trees:

A pine, 24 ins. diam., bears S. 21° W., 32 lks. dist., with healed blaze.

A pine stump, 34 ins. diam., bears N. 34° W., 48 lks. dist., with a down pine alongside, 34 ins. diam., with scribe marks T3S R31E S27 visible on open blaze.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with brass cap marked:

T3S	R31E
S27	S26
S34	S35
1978	

from which new bearing trees

A fir, 11 ins. diam., bears N. 45° E., 68 1/2 lks. dist., mkd. T3S R31E S26 BT.

A fir, 14 ins. diam., bears S. 47 1/2° E., 30 1/2 lks. dist., mkd. T3S R31E S35 BT.

A fir, 17 ins. diam., bears N. 41° W., 35 lks. dist., mkd. T3S R31E S27 BT.

Deposit corner stone alongside iron post.

RECEIVED BY
Umatilla County Surveyor
Date _____
Rec'd By _____
No. 82-138-B