

# OREGON CORNER RESTORATION FORM

SECTION 35 TOWNSHIP 4 NORTH RANGE 29 EAST V-19

COUNTY : UMATILLA DATE 8-98

CORNER DESIGNATION

NORTH 1/4

CONDITION REPORT ONLY  
 NOT FOUND  
 RENEWED  
 UNCOVERED  
 SURVEYED IN  
 REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.


ORIGINALLY SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101. HE SET A POST IN A MOUND OF EARTH AND A CHARRED STAKE..

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

NOTHING

MONUMENT DETAIL

SKETCH

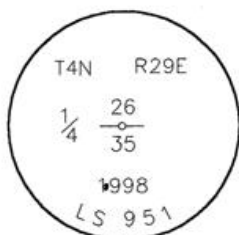

MONUMENT SET ( PROCEDURES AND DESCRIPTION )

BY SINGLE PROPORTION I SET A 1" X 30" IRON PIPE WITH A 2 3/8" BRASS CAP STAMPED AS ABOVE, 3" ABOVE THE SURFACE AND IN AN EAST-WEST FENCE LINE.

NEW ACCESSORIES FROM WHICH

A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES N 89°.13'35" E, 43.90 FEET.  
A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES N 89°.50'30" W, 20.05 FEET.  
A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES S 89.47'40" W, 30.51 FEET.  
AN ALUMINUM TAG #951 IN A RXR TIE FENCE POST LIES S 79°.28'00" E, 123.85 FEET.

LOCATION AND COMMENTS

COMPASS DEC.

SURVEYOR'S SEAL

FIRM/AGENCY  
EDWARDS SURVEYING  
P.O. BOX 763  
HERMISTON, OREGON 97838  
97838

PARTY CHIEF  
D. EDWARDS

NOTES

WITNESS  
CURTIS J FAVOREL

RECEIVED BY

Umatilla County Surveyor

Date 10-98

Rec'd By KK

No. 98-213-C

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*G. Dennis Edwards*

OREGON  
JULY 16, 1971  
G. DENNIS EDWARDS  
951

RENEWS 12/31/99