

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 4N, R 36E., W.M.

Corner Code No. Z-3

Notes: Monument marked as shown below

History of original corner establishment:

This corner was originally established by Odell and Lewis, U.S. Deputy Surveyors, under Contract No. 110 dated February 7, 1885. The original notes state that at the corner a wood post and marked stone was set in a mound of stone.

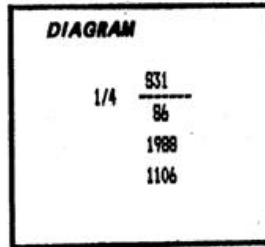

Corner No.
Compass Declination: 19.0°

Description of corner evidence found:

None. The corner area falls on a very steep, rocky hillside.

Description of monument and accessories established to perpetuate the original location of this corner:

Corner position was reestablished by single proportion measure between the Southwest and Southeast corners of Section 31, (there is a fence running between the Southwest and Southeast corners of Section 31). The corner falls on a steep, rocky, unstable hillside, 8' north of a fence. Set a 5/8" by 30" iron rod with 1 1/2" aluminum cap, marked as shown in corner diagram, 24" in the ground and surrounded with a mound of stone from which:

- A 2' by 2' by 3' out of ground rock in place bears S89°E 6.9' marked "X B0" on West face.
- A 2' by 4' by 5' out of ground rock in place bears S31°W 6.8' marked "X B0" on Northeast face.

Set steel fence post West of corner and attached witness corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

7-27-88

Office of Survey County of Umatilla
 State of Ore, I hereby certify that the within instrument was filed in this office
 for record on the 27th day of July, 1988
David H. Lamberson By Laithson L. Ambrucci
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
 Umatilla County Surveyor
 Date 9-88
 Rec'd By LA
 No. 88-42-C