

USDA FOREST SERVICE

CORNER RECORD (SEARCH)

Index

File No. P-23

R.D.: N.F.J.D.

Co. Survey No:

T.4S., R.32E.

N.F.: UMATILLA

County: Umatilla

Meridian: Willamette

CORNER DIAGRAM | DESCRIBE CORNER MONUMENT FOUND

T4S R32E

C1/4

None. Corner established this survey.

S24

1994

PLS 2405

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

None. Corner established this survey.

PHOTO ID DATA

Photo No.

Filed At

Object ID

PLANE CO-ORD

State Zone

X


Y

DESCRIBE CORNER LOCATION:

Estab. By

Corner falls on flat of P.Pine and D.Fir. N-S-E-W fence
corner is N30°E, 60 ft.

Signature:

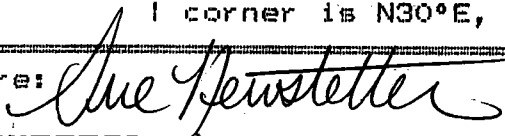

Title: Land Surveyor

Date: 10/21/94

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MON.
Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown
on the DIAGRAM, 20" in the ground and raised a mound of stone and earth
around the monument. From Which:

ACCESSORIES: DESCRIBE NEW BT'S, W.O.'S ETC. ESTABL./WORK DONE TO PRESERVE
Ponderosa Pine, 12" dia., bears N01°39'W, 64.7 ft., scribed: C1/4 S24 BT
Ponderosa Pine, 16" dia., bears N84°25'E, 10.4 ft., scribed: C1/4 S24 BT
Ponderosa Pine, 10" dia., bears S21°57'E, 29.8 ft., scribed: C1/4 S24 BT
Ponderosa Pine, 12" dia., bears S58°39'W, 22.8 ft., scribed: C1/4 S24 BT
Measurements to BT's taken with an Electronic Tacheometer with bearings
based on the survey control network. Set steel fence post with Land Survey
Monument (54-9) sign 5' north of the monument. Nailed a brass washer
stamped PLS 2405 on blaze above BT scribe as taken this survey. Nailed
Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs
on back of each tree as required. Painted a 6" red band above Bearing
Trees signs.

Work Done by: Susan E. Newstetter Dr. Land Surveyor No. 2405 Date: 10/21/94
Certified Cor. Record Prepared? Yes No Filed At: Umatilla Co. Survey.

REMARKS

Index File No. P-23

T.48., R.32E., W.M.