


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-17

History of original corner establishment:

Corner originally established by George S. Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12, 1881. Surveyor General records state: Set basalt stone 18x10x8 on South slope for cor. to Sec. 22, 23, 26 & 27. A pine 26 in. di. brs. N37°E, 100 lks. dist. A fir 8 in. di. brs. S50°E, 14 lks. dist. A fir 7 in. di. brs. S62°W, 34 lks. dist. A pine 10 in. di. brs. N78°W, 39 lks. dist. Corner remonumented by Craig L. Wanless, BLM Cadastral Surveyor under instructions, dated July 18, 1977. His record states: To cor. of secs. 22, 23, 26 & 27, determined from the remains of the original bearing trees: A pine stump 30 ins. diam. bears N50°E, 100 lks. dist. with scribe marks T4SR32ES23 B visible on open blaze. (record N37°E). A fir 18 ins. diam. bears S62°W, 34 lks. dist. with fragmentary scribe marks visible on open and burned blaze. A root hole, bears N78°W, 39 lk dist. with a down and decayed pine alongside, size indeterminate, with scribe marks T4SR32ES22 BT visible on open blaze. At the corner point... Set an iron post 28 ins. long 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base, to top, with brass cap mkd. (as shown in corner diagram) from which new bearing trees... A fir 11 ins. diam. bears N68½°E, 52½ lks. dist. mkd. ~~Description of corner evidence found~~ T4SR32ES23 BT. A lodgepole pine 23 ins. diam. bears S63°E, 42 lks. dist. mkd. T4SR32ES26 BT. A fir 11 ins. diam. bears N10°W, 52 lks. dist. mkd. T4SR32ES22 BT.

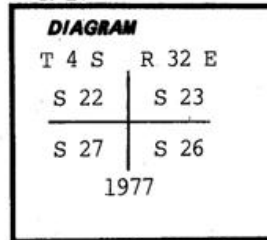

Description of corner evidence found:

Found 2½" iron pipe with 3½" brass cap (as shown in corner diagram) in mound of stone.
 A 12" dead douglas fir brs N68½°E, 34.1' with scribing visible.
 Ponderosa pine sawn stump about 4' high and 32" diam brs N49½°E, 64.2' with scribing visible.
 A 23" ponderosa pine brs S63.3/4°E, 26.8' with scribing visible.
 A 20" douglas fir brs S60½°W, 22.5' with pitched over blaze.
 A 12" douglas fir brs N11°W, 33.7' with pitched over blaze.

Description of monument and accessories established to perpetuate the original location of this corner:

Set steel fence post next to corner with sign 54-9 attached.
 New bearing tree established:
 A 7" ponderosa pine bears N31¼°E, 52.3' scribed T4SR32ES23 BT.
 New BT has a brass washer stamped PLS 1106 nailed to face of blaze.
 Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.
 Compass declination 18° East.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on June 03, 1992.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of... County Surveyor County of... Umatilla
 Oregon
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

R-17

RECEIVED BY

Umatilla County Surveyor *GPO-799-276

Date 7-92

Rec'd By KK

No. 92-80-B