

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 05/06/09

CORNER DESIGNATION: J-7, The South 1/4 Corner of Section 8, Township 5 North, Range 34 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner originally established by Odell & Lewis under GLO Contract No. 110, dated February 7, 1865.

Notes state: Set 1/4 Section post, on steep hill side facing the East, Drove charred stake, dug pits, and raised mound as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL: T5N R34E

1 S8
4 S17
2009
PLS 1106

MONUMENT SET: At a point N 00°39'15" W, 16.99' (grid bearing and distance), from true corner point, set a WITNESS MONUMENT, a 2 3/8" brass cap on a 1 1/4" diameter by 30" galvanized iron pipe, 26" in the ground, stamped as shown in "Monument Marking Detail". The true corner point is at the old fence corner location determined by Steve Haddock on his Survey No. 03-113-C. The fences in this area are decayed and fallen but the fence corner location can still be determined.

New accessories to WITNESS MONUMENT:

A silver deep-1 magnet buried 12 inches below ground level, bears North 37° East, 7.6 feet.

A pink deep-1 magnet buried 12 inches below ground level, bears South 32 1/4°, 11.3 feet.

A 5/8" by 24" rebar with a 1 1/4" red plastic cap, bears South 37° West, 114.26 feet, (grid bearing and distance).

A 5/8" by 24" rebar with a 1 1/4" red plastic cap, bears South 87 1/2° West, 74.88 feet, (grid bearing and distance).


Red plastic caps on rebar accessories are marked "OR PLS 1106, WA PLS 17372" and have bearing object signs attached. Buried bearing object signs with the deep-1 magnets. Set steel fence post 3' north of WITNESS MONUMENT with witness sign.

LOCATION AND COMMENTS: Corner falls on steep East slope of draw. Slope is eroding away North and West, +/-15 feet from cap. Iron rebar bearing object signs near are set near top of slope on more stable soil.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

WITNESS MONUMENT: N = 827115.25 TRUE CORNER: N = 827098.26
E = 8687998.93 E = 8687999.12

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

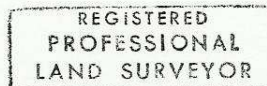


COMPASS DECLINATION: 18° East

Surveyor's Seal

William R. Wells

Witnesses: Matt Brockamp
D. Palmer



15N34J7

renews 6-30-12

RECEIVED BY
Umatilla County Surveyor
Date: 4/3/2012
Rec'd By: [Signature]
No.: 12-029-C