

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 02/22/05

CORNER DESIGNATION: 5N35, J-7, The South Quarter Corner of Section 8.

## PREVIOUS RENEWALS/SURVEYS ETC.:

Originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865.  
Notes state: Set 1/4 Sec. post; drove charred stake; dug pits & raised mound, as per instructions.

In June, 1900, J.W. Kimbrell recovered this corner, but does not state what was found. The Kimbrell record is in Record of Private Surveys, Survey No. 125.

## MONUMENT AND ACCESSORIES FOUND:

None. The corner area falls in an active wheat field.

## MONUMENT MARKING DETAIL:

T5N R35E

1 S8

4 S17

2005

PLS 1106

## MONUMENT SET:

Corner position was re-established by single proportion measurement between the Southeast and Southwest corners of Section 8, using the Odell and Lewis record. At re-established corner position, set a 2 1/2" brass cap on 1 1/4" x 30" iron pipe with cap 18" below ground level in active farmed field. Marked as shown on Monument Marking Detail.

### New accessories:

A silver deep-1 magnet buried 24" below ground level, bears North 47° East, 30.0 feet.  
A purple deep-1 magnet buried 24" below ground level, bears South 39° East, 40.6 feet.  
A blue deep-1 magnet buried 24" below ground level, bears South 41 1/2° West, 36.1 feet.  
An orange deep-1 magnet buried 24" below ground level, bears North 54° West, 39.5 feet.  
Buried bearing object signs with deep 1 magnets.

LOCATION AND COMMENTS: Corner is located in a actively farmed field approximately 80' North of a East-West field access road.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 827288.24

E = 8719926.03

FIRM: William R. Wells, PLS

P.O. Box 1696


Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

/5N35J7

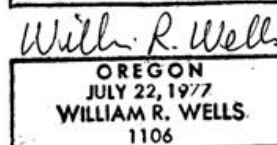

RENWS 6/30/06

05-112-C