

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla DATE: 02/21/05

CORNER DESIGNATION: 5N35, R-03, The South Quarter Corner of Section 19.

**PREVIOUS RENEWALS/SURVEYS ETC.:**

Corner was originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec.; drove charred stake; dug pits & raised mound, as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

**MONUMENT MARKING DETAIL:**

T5N R35E  
1 S19  
4 S30  
2005  
PLS 1106

**MONUMENT SET:**

I accepted an old fence corner with fences North and East as best remaining evidence of the original corner location. Probing and digging around the fence corner did not reveal any other stone or monument. At a point on the South side of the old fence corner post, set a 2 1/2" brass cap on a 2 1/2" x 30" galvanized iron pipe 28" in the ground, marked as shown in Monument Marking Detail.

**New accessories:**

A 5/8" x 24" rebar with yellow plastic cap marked "OR PLS 1106, WA PLS 17372", bears North 87° East, 40.3 feet, (located just South of old fence line).

A purple deep-1 magnet bears South 21° East, 52.5 feet.

A blue deep-1 magnet bears South 48° West, 70.8 feet.

A 5/8" x 24" rebar with yellow plastic cap marked "OR PLS 1106, WA PLS 17372", bears North 05° West, 48.0 feet, (set in North-South fence line).

Buried bearing object signs with the deep-1 magnets, attached bearing object signs to rebar accessories. Nailed "witness" sign to fence corner post North of corner monument.

LOCATION AND COMMENTS: Accepted old fence with fences East and North as best remaining evidence.

**OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:**

N = 816870.49  
E = 8715092.88


FIRM: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Surveyor's Seal

Witnesses: Jason Wells, LSIT

/5N35R03

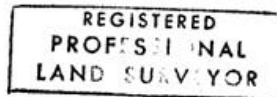

*William R. Wells*

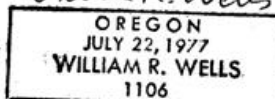

*Renews 6/30/06*

05-112-C