

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 2/20/08

CORNER DESIGNATION: L-1, the West One-Quarter Corner of Section 18, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec post on Level. Drove charred stake, dug pits, raised mound as per instructions. The corner was recovered by J. C. Arnold, County Surveyor, in survey recorded at Book 1, Page 267, Record of Private Surveys. Arnold remonumented with a 21 x 10 x 6" stone, 4 feet South of a East-West fence line. This corner was reestablished by proportional measure between the Northwest closing corner and Southwest corner of Section 18, using the Odell and Lewis record, by Paul Tomkins, under Survey No. 90-074-B.

MONUMENT AND ACCESSORIES FOUND: None. Corner point falls in farmed field, 4' South of an old East-West fence line.

## MONUMENT MARKING DETAIL:

T6N  
R35E 1/4 R36E  
S13|S18  
2008  
PLS 1106

## MONUMENT SET:

Corner point was reestablished on line between the Northwest Closing Corner and Southwest Corner of Section 18, holding the J. C. Arnold call of 4 feet South of an East-West fence line. At the reestablished corner point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with cap buried 16" below ground level, marked as shown in "Monument Marking Detail". I did not hold the corner monument established under Survey No. 90-074-B.

## New accessories:

A 5/8" x 24" rebar with a red plastic cap marked "OR PLS 1106, WA PLS 17372", bears North 85 1/2° East, 27.5 feet, in a E-W fence line.

A 5/8" x 24" rebar with a red plastic cap marked "OR PLS 1106, WA PLS 17372", bears North 82 1/2° West, 35.8 feet, in a E-W fence line.

A 5/8" x 24" rebar with a red plastic cap marked "OR PLS 1106, WA PLS 17372", bears North 48° West, 5.3 feet, in a E-W fence line.

The 2 1/2" brass cap on galv. iron pipe monument, established for the corner point on Survey No. 90-074-C bears South 00°13'00" West, 46.05 feet, buried 15" below ground.

All rebar accessories in E-W fence line have a bearing object sign wired to them. There is a witness sign on fence post about 42 feet West of corner point..

LOCATION AND COMMENTS: Corner falls in farmed field, 4 feet South of East-West fence.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 857288.29

E = 8742949.18

FIRM: Wells Surveying

P.O. Box 1696

Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Witnesses: Jason Wells, LSIT

\6N36L1

Surveyor's Seal



*Will. R. Wells*

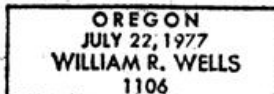

09-10-C