

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 03/06/08

CORNER DESIGNATION: N-3, The North One-Quarter Corner of Section 19, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post. Drove charred stake; dug pits & raised mound, as per instructions.

John Kimbrell, in his survey shown in a diagram in Book 1, Page 315, Record of Private Surveys, shows he calculated a position for this corner, but it is unclear whether the corner was reestablished.

The position for this corner was calculated on Survey No. 08-049-B.

MONUMENT AND ACCESSORIES FOUND: None. Corner area falls in E-W ditch.

## MONUMENT MARKING DETAIL:

T6N R36E  
1 S18  
4 S19  
2008  
PLS 1106

MONUMENT SET: Corner point was reestablished on the North line of Section 19, on the Northerly projection of a line between the Center one-quarter corner and a old fence corner found at the C-N 1/16th Corner. See Survey No. 08-049-B. The reestablished position fits the location of Telephone Pole Road, to the West, very well. At the reestablished corner position, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with cap buried 12" below ground level, in the bank of a East-West ditch, marked as shown in "Monument Marking Detail".

### New accessories:

A 3/4" brass washer stamped "PLS 1106" in West end of cut off 5" diameter willow tree branch, bears North 81° East, 15.1 feet.

A 5/8" x 24" iron rebar with a red plastic cap stamped "OR PLS 1106, WA PLS 17372" bears South 86° East, 48.6 feet. This rebar is on the South bank of a ditch, just North of a 1 3/4" pipe, embedded in the ground at ground level.

A white and red gas line marker post on south side of ditch bears South 89° West, 83.2 feet. Measured to where marker post goes in the ground.

A 5/8" x 24" iron rebar with a red plastic cap marked "OR PLS 1106, WA PLS 17372", on North bank of ditch bears North 08° West, 18.4 feet, buried flush with ground.

Attached bearing object signs to all accessories except white gas post.

Set steel fence post with witness sign attached 1.5 feet North of monument.

LOCATION AND COMMENTS: Corner falls in sloping bank of ditch. Corner falls 10 feet South of ditch centerline and 4 feet North of South top of bank.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 854684.58

E = 8745675.49


FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Witnesses: Jason Wells, LSIT

\6N36N3

Surveyor's Seal

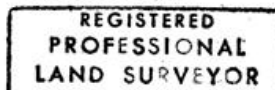

*William R. Wells*



09-10-e