

**OREGON CORNER RESTORATION FORM**

Section 30 Township 6N Range 36E  
 County Umatilla Date: November 20, 2007

Corner Designation: 6N36V3



Quarter corner common to sections 30 and 31, T6N, R36E, W.M., Umatilla County, Oregon.

Condition Report Only  
 Not found  
 Remonumented  
 Unrecorded  
 Surveyed in  
 Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by Odell and Lewis under contract No. 110 dated February 7, 1865. Their record reads: Set 1/4 Sec. post. Drove charred stake; dug pits & raised mound as per instructions. This corner was found in the survey in the Record of Private Surveys Book 1, Page 315 but no monument was identified.

Monument and Accessories found: ( condition and source )  
 None.

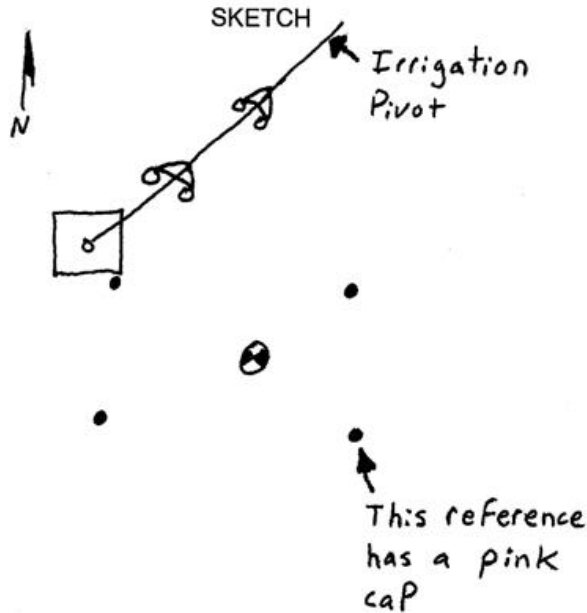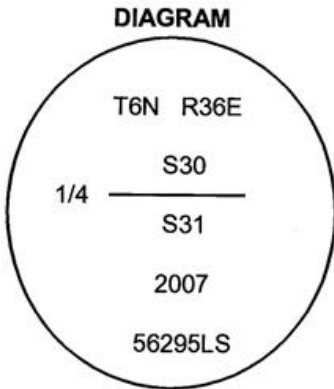

- ⊗ = Brass Cap
- = Rebar Reference

**MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)**

At the proportionate point I set a 1 1/2"x30 galvanized iron pipe with a 2 1/4" brass cap stamped as shown in the diagram above.

For references, I set four 5/8" by 24" rebars with 1.25" plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears N61°40'52"W, 32.32 feet with an orange cap;
- an iron rebar bears S55°35'08"W, 43.05 feet, 2' below the surface with an orange cap;
- an iron rebar bears S29°30'43"E, 28.62 feet, 2 feet below the surface with a pink cap;
- an iron rebar bears N63°20'14"E, 29.72 feet, 2 feet below the surface with an orange cap;

The monument was set and references were tied using a Trimble R7/R8 RTK GPS.

Location and comments

Compass Declination

Surveyors Seal

RECEIVED BY:  
Umatilla County Surveyor  
 Date: 02-08  
 Rec'd By: [Signature]  
 No. 08-039-C

Firm / Agency  
 Witness Tree Surveying  
 Address  
 P.O. Box G  
 Pilot Rock, Or. 97868  
 Party Chief  
 Stephen K, Haddock

REGISTERED PROFESSIONAL LAND SURVEYOR  
*Stephen K. Haddock*  
 OREGON  
 JULY 9, 2001  
 STEPHEN K. HADDOCK  
 56295LS  
 RENEWAL DATE 6-30-09