

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 07/18/08

CORNER DESIGNATION: X-17, The East One-Quarter Corner of Section 34, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post. Drove charred stake; dug pits & raise mound as per instructions.

A.L. Coffey, County Surveyor, in his survey recorded at Book 1, Page 68, Record of Private Surveys, indicates he recovered the 1/4 section corner post in September, 1882.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T6N R36E

$\frac{1}{4}$

S34 | S35

2008

PLS 1106

MONUMENT SET: Corner reestablished on line between the Southeast and Northeast corners of Section 34, holding a field line extending West for latitude. At the reestablished corner point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe with cap flush at ground level, marked as shown in "Monument Marking Detail".

New accessories:

A 3/4" brass washer stamped "PLS 1106" in power pole with transformer, 1 foot above ground level, bears North 63° East, 18.1 feet. Nailed witness sign to pole.

A 5/8" x 30" rebar with a red plastic cap marked "OR PLS 1106, WA PLS 17372", bears South 61° East, 43.6 feet. Located in East road bank.

A 3/4" brass washer stamped "PLS 1106" in a 6 foot pole, 1 foot above ground level, bears South 07 1/2° East, 99.7 feet. Located on West side of the road.

A 3/4" brass washer stamped "PLS 1106" in 18' +/- pole with power meter and antenna, 1 foot above ground level, bears South 58° West, 6.7 feet.

Attached bearing object signs to the poles and rebar accessories.

LOCATION AND COMMENTS: Corner located 29 feet from centerline of Hood Road, in line with field line extending West. See discussion of road location relative to Section line on Land Corner Record Z-17.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 842094.61

E = 8764664.24


FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Surveyor's Seal

Witnesses: Jason Wells, LSIT

\6N36X17

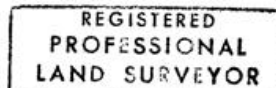

William R. Wells

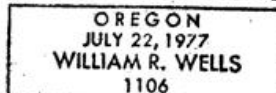

Expires 6-30-10

09-10-c