

witness post just southwest of trail, bears S. 60° W., 31.8 ft.
A 5/8" x 30" rebar marked "TLS-HDJ" with "T" post, 0.60 ft. to north.

LOCATION AND COMMENTS:

Corner is in a fairly level area of smaller "Christmas tree" sized fir trees, approximately 25' Easterly of old road. Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:
N = 843482.13
E = 8801222.32

COMPASS DECLINATION: 15° East


SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Thomas J. Boshart
Felipe G. Hernandez
Corey A. West
Timothy K. Bannister



Greg E. Flowers

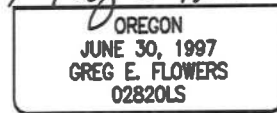

RENEWS 12/31/15

06/29/2015

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 06/03/2014

CORNER DESIGNATION: X-21, Quarter Corner Section for Sections 36 and 35, Township 6 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by A.H. Simmons for Deputy Surveyor George Williams under his contract No. 176 dated October 23, 1872; his notes state "Set post for quarter section corner for Sections 35 & 36, from which a Tamarac 12 inch diameter bears S25°E 5 links distance, a Tamarac 14 inch diameter bears S18°W 8 links distance.

Surveyor John Kimbrell, in his surveys recorded at Book 1, Page 248, dated October 3, 1906 state "Commencing at the ¼ Section Corner between Sections 35 & 36 then south between Sections 35 and 36." Kimbrell does not report what was found.

Surveyor Paul W.P. Tomkins noted in his October 15, 1999 survey, shown on Umatilla County Survey record of surveys 99-258-C, "Corner was originally established by Odell and Lewis under Contract No. 110 dated February 7, 1865, as a basalt stone, 14"x11"x8" on a steep east facing slope. Evidence Found: We found a firmly set basalt stone 15"x11"x7", in mound of smaller stones and earth, on a northerly facing prominence on a steep northeast facing slope. Perpetuation Information: Set 5/8" x 30" rebar with yellow cap marked "Tomkins Surveying", at the location of the rock and placed the rock alongside a 12" Fir bears N35°W 9.0' from the corner and a 10" Fir bears S5°W 4.5' from the corner. Trees were not scribed, however bearing object signs were attached to them, and they were painted with 6" wide red bands.

Surveyor Paul W.P. Tomkins noted in his August 13, 2001 survey, shown on Umatilla County Survey record of surveys 01-132-C, "S.W. Corner of the N.W ¼ of Sec. 36 found rebar, yellow cap, fence post set and described per survey 99-258-C.

MOUNUMENT AND ACCESSORIES FOUND:

Found a yellow plastic cap stamped "Tomkins Survey" on a 5/8 inch iron rebar approximately 1 inch above ground with a T-post approximately 7 inches north.

A dead 10 inch diameter Fir blazed and bearing a tag that bears S60°W 86.4 feet, painted said tree.

Found a 20 inch diameter Ponderosa Pine with a healed blaze and bearing a tag that bears S42°E 52.8 feet, painted said tree.

Found 2 ½" pipe at fence corner as noted in Tomkins 1999 survey, bears S20°W 109.0, attached bearing tag to pipe.

MOUNUMENT MARKING DETAIL:

T6N R37E	
— S36 —	1/4
S35	
2014	
LS 2820	

MOUNUMENT AND ACCESSORIES SET:

At the position of the found rebar, set 1 ½" x 30" galvanized iron pipe with 2 ½" brass disk stamped as sketched. Placed rock a long side as a witness.

A 14 inch diameter White fir bears N62°E 36.5 blazed, scribed, tagged and painted accordingly.

Set a 5/8" x 30 iron rebar with cap marked "TLS-HDJ" 3" above ground with "T" Post, as a